

Department of Energy

Portsmouth/Paducah Project Office 1017 Majestic Drive, Suite 200 Lexington, Kentucky 40513 (859) 219-4000

MAR 23 2011

Mr. Wm. Turpin Ballard Remedial Project Manager U.S. Environmental Protection Agency, Region 4 61 Forsyth Street Atlanta, Georgia 30303

Mr. Edward Winner, FFA Manager Kentucky Department for Environmental Protection Division of Waste Management 200 Fair Oaks Lane, 2nd Floor Frankfort, Kentucky 40601

Dear Mr. Ballard and Mr. Winner:

TRANSMITTAL OF THE D2 FISCAL YEAR 2011 SITE MANAGEMENT PLAN, PADUCAH GASEOUS DIFFUSION PLANT, PADUCAH, KENTUCKY

Please find enclosed the certified D2 Site Management Plan (SMP), Paducah Gaseous Diffusion Plant, Paducah, Kentucky, Annual Revision FY 2011, DOE/LX/07-0348&D2, for your review. The enclosed D2 SMP incorporates comments received from the U.S. Environmental Protection Agency and the Kentucky Department for Environmental Protection on February 1, 2011 and February 8, 2011, respectively, as well as additional comments/clarifications received during comment resolution meetings held on February 23, 2011 and March 17, 2011. A redline version of the D2 SMP and comment response summaries also are provided to assist with your review.

If you have any questions or need any additional information, please contact David Dollins at (270) 441-6819.

Sincerety

Reinhard Knerr Paducah Site Lead

Portsmouth/Paducah Project Office

PPPO-02-1136228-11B

Enclosure:

D2 FY 2011 SMP

cc w/enclosure: DMC/Kevil

e-copy w/enclosure:

alicia.scott@lataky.com, LATA/Kevil ballard.turpin@epamail.epa.gov, EPA/Atlanta barbara.mazurowski@lataky.com, LATA/Kevil brandy.mitchell@lataky.com, LATA/Kevil christie.lamb@lataky.com, LATA/Kevil dave.dollins@lex.doe.gov, PPPO/PAD edward.winner@ky.gov, KDEP/Frankfort gaye.brewer@ky.gov, KDEP/Paducah jana.white@lataky.com, LATA/Kevil jeffrey.gibson@ky.gov, KDEP/Frankfort leo.williamson@ky.gov, KDEP/Frankfort myrna.redfield@lataky.com, LATA/Kevil reinhard.knerr@lex.doe.gov, PPPO/PAD rob.seifert@lex.doe.gov, PPPO/PAD todd.struttmann@lataky.com, LATA/Kevil tufts.jennifer@epamail.epa.gov, EPA/Atlanta

CERTIFICATION

Document Identification:

Site Management Plan, Paducah Gaseous Diffusion Plant, Paducah, Kentucky, Annual Revision FY 2011, DOE/LX/07-0348&D2, March 2011

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to ensure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

LATA Environmental Services of Kentucky, LLC

Barbara A. Mazurowski, Paducah Project Manager

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to ensure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons directly responsible for gathering the information, the information submitted is to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

U.S. Department of Energy

Reinhard Knerr, Paducah Site Lead Portsmouth/Paducah Project Office

Site Management Plan Paducah Gaseous Diffusion Plant Paducah, Kentucky

Annual Revision—FY 2011



CLEARED FOR PUBLIC RELEASE

Site Management Plan Paducah Gaseous Diffusion Plant Paducah, Kentucky

Annual Revision—FY 2011

Date Issued—March 2011

Prepared for
U.S. Department of Energy
PADUCAH GASEOUS DIFFUSION PLANT
Paducah, Kentucky 42002
by
LATA ENVIRONMENTAL SERVICES OF KENTUCKY, LLC
under contract DE-AC30-10CC40020
with contributions by
U.S. Environmental Protection Agency
Kentucky Energy and Environmental Cabinet
Kentucky Cabinet for Health and Family Services

CLEARED FOR PUBLIC RELEASE




CONTENTS

FIGURES	v
ACRONYMS	vii
1. INTRODUCTION	1
2. LAND USE	2 2
3. OPERABLE UNITS	2
4. SITE PRIORITIZATION	3
APPENDIX 1: ACTIONS TAKEN TO DATE	1-1
APPENDIX 2: CERTIFICATION OF LUCIPS	2-1
APPENDIX 3: OPERABLE UNIT SCOPE DESCRIPTIONS AND KEY PROJECT ASSUMPTIONS	3-1
APPENDIX 4: SOURCE AREA BY OPERABLE UNIT	4-1
APPENDIX 5: ENFORCEABLE TIMETABLES AND DEADLINES; PLANNING DATES WITH LONG-TERM TARGETS	5-1
APPENDIX 6: DATA MANAGEMENT PLAN	6-1



FIGURES

1.	Current Land Use at PGDP	4
2.	Reasonably Anticipated Future Land Use at PGDP	. 5
3.	Conceptual Framework—PGDP Operable Units	6



ACRONYMS

AOC area of concern

CERCLA Comprehensive Environmental Response, Compensation, and Liability Act

CSOU Comprehensive Site Operable Unit D&D decontamination and decommissioning

DOE U.S. Department of Energy EM Environmental Management

EPA U.S. Environmental Protection Agency

FFA Federal Facility Agreement

FY fiscal year

GDP gaseous diffusion plant

LOI Letter of Intent
LUC land use controls

LUCAP Land Use Controls Assurance Plan LUCIP Land Use Control Implementation Plan

NCP National Contingency Plan NPL National Priorities List

OU operable unit

PGDP Paducah Gaseous Diffusion Plant RACR Remedial Action Completion Report

RAO Remedial Action Objective

RCRA Resource Conservation and Recovery Act

SMP Site Management Plan

SWMU solid waste management unit



1. INTRODUCTION

The Paducah Gaseous Diffusion Plant (PGDP) was placed on the National Priorities List (NPL) on May 31, 1994. In accordance with Section 120 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA), the U.S. Department of Energy (DOE) entered into a Federal Facility Agreement (FFA) with the U.S. Environmental Protection Agency (EPA) and Kentucky on February 13, 1998. The FFA established one set of consistent requirements for achieving comprehensive site remediation in accordance with the Resource Conservation and Recovery Act (RCRA) and CERCLA, including stakeholder involvement.

Section XVIII of the FFA requires that DOE submit an annual Site Management Plan (SMP), which outlines DOE's strategic approach for achieving cleanup under the FFA, to EPA and the Energy and Environment Cabinet (formerly known as the Kentucky Environmental and Public Protection Cabinet) by November 15th of each year. The FFA states that the purpose of the SMP is to coordinate and document the potential and selected operable units (OUs), including removal actions; to define cleanup priorities; to identify work activities that will serve as the basis for enforceable timetables and deadlines under the agreement; and to establish long-term cleanup goals.

DOE and Kentucky entered into a Letter of Intent (LOI) in August 2003. EPA was not a signatory to the LOI. The LOI documents the commitment by Kentucky and DOE to promote accelerated cleanup at PGDP, develop an integrated planning and funding request, meet commitments under the FFA, and settle all identified outstanding enforcement and compliance issues through an Agreed Order. The LOI does not affect DOE's legal obligation to comply with the National Contingency Plan (NCP) or FFA. An Agreed Order between DOE and Kentucky, which incorporated certain provisions of the LOI related to waste management, was signed in 2003.

The fiscal year (FY) 2004 SMP officially incorporated the provisions of the SMP Agreement signed by DOE, EPA, and Kentucky on April 14, 2003, and input from various strategic planning meetings between DOE and the regulators.

Specifically, the FY 2004 SMP established enforceable milestones for FY 2004, FY 2005, and FY 2006, and outlined enforceable completion dates for investigation and response actions associated with the strategic cleanup initiatives below.

This annual update of the SMP sets forth enforceable milestones for FY 2011, FY 2012, and FY 2013, and enforceable completion dates for media-specific OUs associated with the strategic cleanup initiatives.

Strategic Cleanup Initiatives

- Groundwater OU Strategic Initiative
- Burial Grounds OU Strategic Initiative
- Surface Water OU Strategic Initiative
- Soils OU Strategic Initiative
- Decontamination and Decommissioning (D&D)
 OU Strategic Initiative

These initiatives include a series of prioritized response actions, ongoing site characterization activities to support future response action decisions, and D&D of the currently operating gaseous diffusion plant (GDP) once it ceases operation. After completion of these activities, Comprehensive Site OU (CSOU) evaluation will be conducted, with implementation of additional needed. to ensure long-term actions. as of human protectiveness health and the environment. CERCLA 5-Year Review evaluations are and will continue to be conducted to determine if any modifications to actions are required prior to the CSOU evaluation.

Appendix 1 of this SMP contains a summary of the status of all actions taken to date that have been documented through a Record of Decision or Action Memorandum. This appendix also serves to meet the requirements of Section X.A of the FFA to submit an annual removal action report describing a summary of removal actions performed during the previous FY. More detailed information on the status of each OU is available in the FFA Semiannual Progress Report.

2. LAND USE

The planning assumption for current land use (Figure 1) and the reasonably foreseeable future land uses at and adjacent to PGDP (Figure 2) are for industrial areas primarily located inside the security fence, recreational areas located outside the security fence, and off-site residential areas.

Several factors were considered in establishing the land-use assumptions under this strategy, including current and past land use, existing lease commitments, future industrial missions planned at the site, and stakeholder input.

2.1 LAND USE CONTROLS

The site cleanup strategy recognizes that the long-term protectiveness of some response actions might rely upon, or be supplemented by, engineering barriers, institutional controls, and/or other land use controls (LUCs). To ensure that these controls remain protective, CERCLA five-year reviews, in conjunction with monitoring of requirements contained in the Land Use Control Assurance Plan (LUCAP), are implemented.

A Land Use Control Implementation Plan (LUCIP) is developed for each remedy that includes LUCs. The LUCIPs include a detailed explanation of the implementation and long-term maintenance of the LUCs. The LUCAP requires annual certification in the SMP that the LUCIPs are being implemented. This certification also will identify any noncompliance with a LUCIP and the steps taken to correct any such noncompliance, any nonmajor changes in land use, and any changes in designated officials. Appendix 2 contains the annual certification of LUCIPs implemented at PGDP.

3. OPERABLE UNITS

Site cleanup activities will occur in a sequenced approach consisting of (1) pre-shutdown scope, (2) post-shutdown scope, and (3) CSOU scope. The pre-shutdown scope is associated with mediaspecific OUs initiated prior to shutdown of the operating Gaseous Diffusion Plant (i.e., Pre-GDP Shutdown Activities). These media-specific OUs

were established by developing a site conceptual risk model for each source area [solid waste management units (SWMUs)/areas of concern (AOCs)]. This process included a qualitative evaluation of contaminant types and concentration, release mechanisms, likely exposure pathways, estimated points of exposure, and potential receptors based on current and reasonably foreseeable future land groundwater uses. The source areas for the Pre-GDP shutdown scope have been grouped into these media-specific OUs:

- Groundwater OU
- Surface Water OU
- Soils OU
- Burial Grounds OU
- D&D OU

Once the GDP ceases operation and a decision has been made to proceed with D&D of the GDP, a series of post-GDP shutdown activities will be implemented. Figure 3 depicts a conceptual relationship approach outlining the generalized framework for site cleanup activities shutdown. with post-GDP associated conceptual planning purposes, the following OUs tentatively have been identified as placeholders for site cleanup activities likely to occur during the post-GDP phase of the cleanup:

- GDP Groundwater Sources OU
- Additional Burial Ground Sources OU
- GDP D&D OU
- Soils and Slabs OU
- GDP Lagoons & Ditches OU

Six months prior to plant shutdown, the FFA parties intend to commence planning to further define the implementation approach, and it will be included in the appropriate annual update of the SMP.

The final CSOU evaluation will occur following plant shutdown and completion of D&D of the GDP, D&D of the Depleted Uranium Hexafluoride (DUF₆) Conversion Plant, and completion of post-shutdown cleanup of each of the specific OUs (e.g., GDP Groundwater Sources OU, Soils and Slabs OU). Any required environmental monitoring of remedy performance and/or progress toward achieving the RAOs will be conducted and reported in accordance with the selected remedies. Once no further response is appropriate, and all RAOs have been achieved, the site would be eligible for deletion

from the NPL. Appendix 3 includes additional information regarding scope and planning assumptions for the OUs. Appendix 4 contains lists of SWMUs and AOCs sorted by OUs.

4. SITE PRIORITIZATION

DOE uses a combination of factors to prioritize work being implemented under the Environmental Management (EM) program at PGDP. These include considerations such as regulator expectations, risk-based decision making, compliance with other programs, technical considerations associated with GDP operations, mortgage reduction, and demonstrated progress toward completing the EM mission.

Risk Prioritization Criteria

- Mitigate immediate threats, both on- and offsite.
- Reduce further migration of off-site contamination.
- Address sources contributing to off-site contamination.
- Address remaining sources contributing to onsite contamination.
- Perform D&D of the GDP and DUF₆ Plant once they cease operations.
- Address post-GDP OUs.
- Evaluate the final CSOU.

The risk prioritization criteria incorporate the general program-management principles of the NCP, which emphasize the use of accelerated actions to address imminent threats and reduce migration of off-site contamination.

Consistent with those principles, the risk prioritization criteria described above are used as guidelines, in conjunction with the other previously mentioned factors, to prioritize response actions. The prioritization criteria have been applied to each of the OUs at PGDP. Enforceable milestones for FY 2011, FY 2012, FY 2013, and outyear enforceable completion dates consistent with these prioritization criteria are included in Appendix 5. With regard to pre-GDP scope, outyear enforceable completion dates for remedial actions shall be considered satisfied upon issuance of a D1 Remedial Action Completion Report (RACR) (i.e., Final Remedial Action Report as specified in FFA) for those areas where RAOs have been achieved. In cases where a period of operations and maintenance (O&M) may required to achieve RAOs, such as groundwater, a D1 Interim RACR will be issued upon completion of remedial construction and a determination by DOE that the remedy is operating as intended. The outyear enforceable milestone for completion of the pre-GDP shutdown Groundwater OU, as specified in Section XVIII.C, "Timetables and Deadlines" of the FFA, will be satisfied upon issuance of a D1 Interim RACR. The D1 Final RACR for groundwater then will be issued once the RAOs have been achieved. The pre-GDP shutdown D&D OU consists of multiple removal actions for specific facilities and will be considered complete upon issuance of a Removal Action Completion Notification letter for the OU.

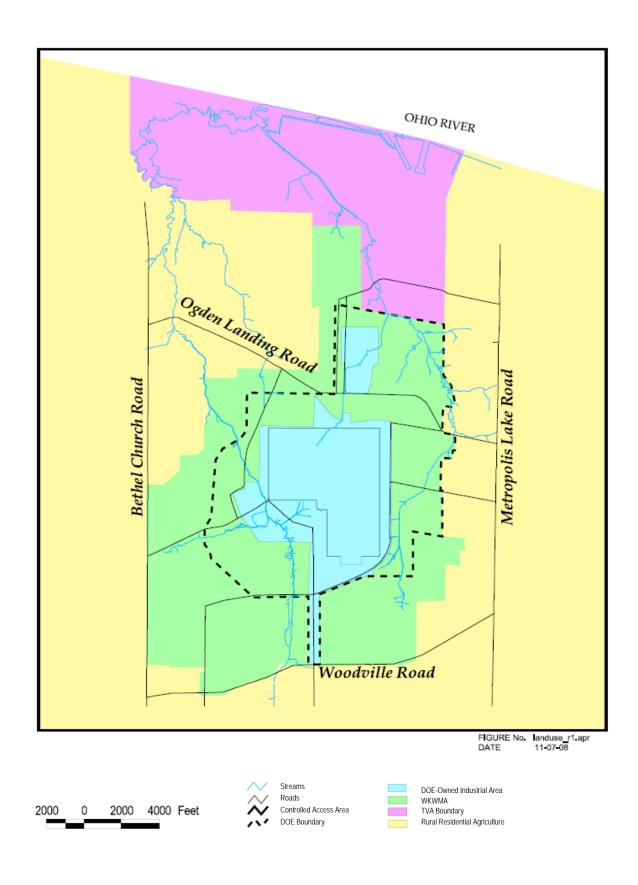


Figure 1. Current Land Use at PGDP

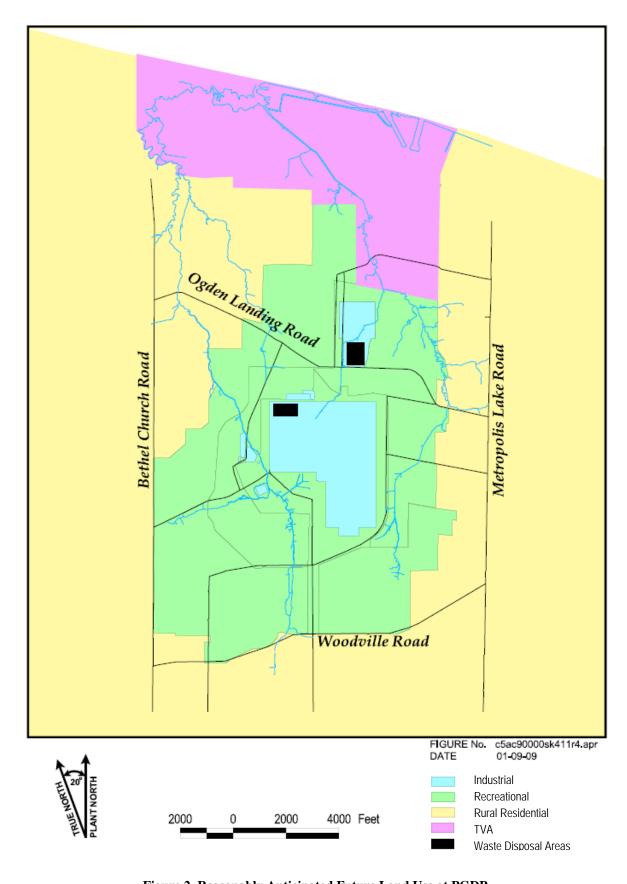


Figure 2. Reasonably Anticipated Future Land Use at PGDP

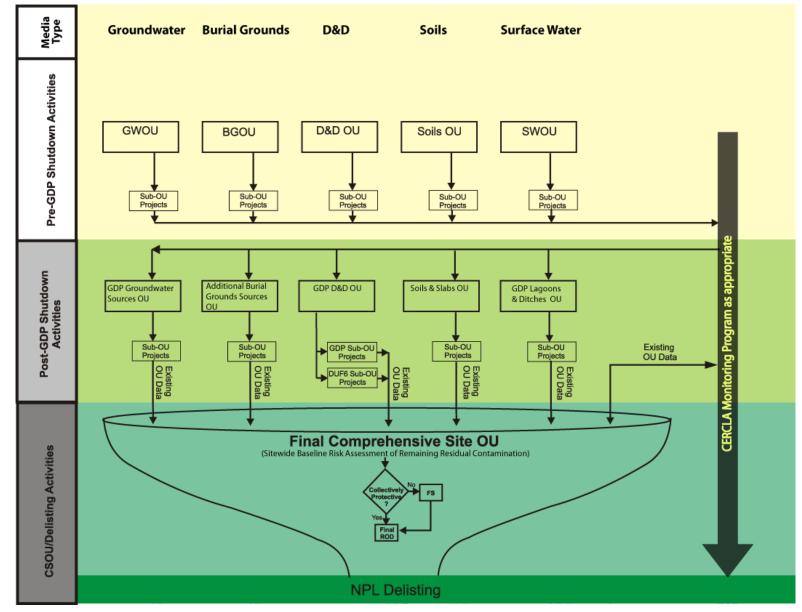


Figure 3. Conceptual Framework—PGDP Operable Units

APPENDIX 1 ACTIONS TAKEN TO DATE



Operable Unit Summary

WAGs/Media	Response Type	ROD/Action Memorandum	Response Description	Status ¹			
	GROUNDWATER OPERABLE UNIT						
WAG 26/Groundwater	Emergency removal action	N/A	Provided temporary water to local residences where private wells are contaminated by TCE and Tc-99.	Complete			
WAG 26/Groundwater	Removal action	August 30, 1994	Extended municipal water line to residences affected by off-site groundwater contamination.	Construction Complete/Operational			
WAG 26/Groundwater (Northwest Plume)	Interim Remedial Action (IRA)	July 23, 1993	Hydraulic containment and treatment of high concentrations of off-site TCE contamination in the Northwest Plume.	Construction Complete/Operational			
WAG 26/Groundwater (Northeast Plume)	IRA	June 15, 1995	Hydraulic containment and treatment of high concentrations of off-site TCE contamination in the Northeast Plume.	Construction Complete/Operational			
SWMU 91/Soil	IRA	August 10, 1998	<i>In situ</i> treatment of TCE-contaminated soils using the LASAGNA TM technology.	Complete			
SWMU 11 and SWMU 533/Groundwater (C-400 Source Action)	IRA	August 9, 2005	In situ treatment of TCE source areas in the UCRS and RGA located in the southeast and southwest corners of the C-400 Building using electrical resistance heating technology.	ROD signed; RDSI completed; design work completed. Field start implemented in FY 2009. Field operations for Phase I completed in FY 2011. Planning of Phase II is currently underway. Parties have agreed to divide Phase II into Phase IIa and Phase IIb. Field sampling is planned in FY 2011 to address Phase II uncertainties.			

¹ Detailed information on the status of each project or operable unit is available n the FFA Semiannual Report.

Operable Unit Summary (Continued)

		ROD/Action				
WAGs/Media	Response Type	Memorandum	Response Description	Status		
SURFACE WATER OPERABLE UNIT (Continued)						
WAG 25/Surface water	IRA	March 28, 1994	Instituted action to treat certain plant effluent	Construction		
(NSDD)		,	and control the migration of contaminated	Complete/Operational		
, , ,			sediment associated with the NSDD.			
WAGs 18 & 25/Surface	IRA	N/A	Institutional controls (fencing/posting) for off-	Construction		
water and sediment			site contamination in surface water, outfalls, and	Complete/Operational		
(Surface Water/Ditches)			lagoons.			
WAG 24/Scrap (Scrapyards)	IRA	N/A	Installation of sediment controls to mitigate	Construction		
			surface water/sediment runoff from scrap yards.	Complete/Operational		
WAGs 1&7	IRA	August 10, 1998	Interim remedial action installed riprap along	Construction		
			creek bank to prevent direct contact,	Complete/Operational		
WAG 1: SWMU 100 (Fire			implemented institutional controls, and long-			
Training Area) and SWMU			term monitoring for SWMU 8. All other			
136 (C-740 TCE Spill Site)			SWMUs were determined to require "no further			
			action" under the IRA. It should be noted that at			
WAG 7: SWMU 8			SWMU 100, institutional controls were selected			
(C-746-K Landfill), SWMU			as part of the remedy.			
130 (C-611 550-gal						
Gasoline UST), SWMU 131						
(C-611 50-gal Gasoline						
UST), SWMU 132 (C-611						
2,000-Gal. Oil UST),						
SWMU 133 (C-611 Grouted						
UST), and SWMU 134						
(C-611 1,000-gal						
Diesel/Gasoline Tank)						
Drum Mountain (Scrap)	Non-time-critical removal action	March 27, 2000	Removed and disposed of Drum Mountain.	Complete		
WAG 24, WAG 14, and	Non-time-critical	September 26, 2001	Removed and disposed of scrap metal with	Complete		
SWMU 99/Scrap	removal action		enhanced sediment control measures.			
SWMU 59/Sediment	IRA	September 25, 2002	Remedial action for Sections 1 and 2 of the NSDD.	Complete		

		ROD/Action			
WAGs/Media	Response Type	Memorandum	Response Description	Status	
SURFACE WATER OPERABLE UNIT (Continued)					
SWMU 58 (Sections 3, 4, and 5 of the NSDD); SWMU 69 (Outfall 001); SWMU SWMU 63 (Outfall 008); SWMU 66 (Outfall 010); SWMU 67 (Outfall 011); and SWMU 68 (Outfall 015) and their associated internal ditches and areas (including SWMUs 92 and 97)	Non-time-critical removal action	April 23, 2009	Removal action for contaminants associated with sediment in Sections 3, 4, and 5 of the NSDD and KPDES Outfalls 001, 008, 010, 011, and 015, and associated internal ditches and areas of PGDP.	Action Memorandum signed; Removal Action Work Plan finalized; field work completed in FY 2010; Removal Action Report developed and issued for regulatory review and approval.	
]	BURIAL GROUND (OPERABLE UNIT		
WAG 22/Waste and soil (SWMU 2-Burial Ground)	IRA	September 11, 1995	The interim ROD selected an impermeable cap to reduce leachate migration from surface infiltration, groundwater monitoring, and institutional controls. Through agreement of the parties, an impermeable cap was not constructed (Waste Area Grouping (WAG) 22 Post-Record of Decision (ROD) Change, October 23, 1996). This change also will be documented in the Final Remedial Decision for SWMU 2.	Additional alternatives are being evaluated under the BGOU project. Institutional controls and groundwater monitoring are ongoing.	
SOILS OPERABLE UNIT					
C-750-A, -B, and -C USTs	N/A	N/A	Tank removal.	Complete	
WAG 7 SWMU 8 (C-746-K Landfill)	IRA	N/A	Enhanced existing cap to reduce leachate migration from surface infiltration.	Complete	

\vdash	
9	

WAGs/Media	Response Type	ROD/Action Memorandum	Response Description	Status
		SOILS OPERABLE	UNIT (Continued)	
AOC 124 WAG 17/Soil (Concrete Rubble Piles)	Removal action	N/A	Excavated soil associated with AOC 124.	Complete
WAG 23/Soil	Removal action	September 11, 1997	Excavated PCB and dioxin-contaminated surface soils to reduce risks to plant industrial workers.	Complete
SWMU 193/Soil	Time-critical removal action	February 19, 2002	Removed petroleum-contaminated soils.	Complete
SWMUs 76 and 519/Soil	Time-critical removal action	July 1, 2002	Removed empty sulfuric acid tanks, size reduced for containerization and dispositioned.	Complete
SWMU 19 [C-410-B Hydrogen Fluoride (HF) Neutralization Lagoon], SWMU 40 (C-403) and SWMU 181 (C-218 Firing Range)	Non-time-critical removal action	May 11, 2009	Removal of lead-contaminated soil at the C-218 Firing Range (SWMU 181). Removal of contamination within the respective SWMU boundaries of C-410-B (SWMU 19). Removal of contamination within the respective SWMU boundaries of C-403 (SWMU 40).	Action Memorandum signed; field work for SWMUs 19 and 181 completed in FY 2010; Removal Action Report for SWMUs 19 and 181 developed and issued for regulatory review and approval. SWMU 40 removal will be implemented in the post-shutdown phase. This schedule change has been documented in the Administrative Record.

Operable Unit Summary (Continued)

WAGs/Media	Response Type	ROD/Action Memorandum	Response Description	Status			
	D&D OPERABLE UNIT						
SWMU 478/Infrastructure (C-410)	Non-time-critical removal action	August 3, 2002	Remove process equipment and piping.	Fieldwork in progress.			
SWMU 478/Infrastructure (C-410)	Non-time-critical removal action	November 23, 2009	Addendum to document a change in scope of the removal action to 1) expand the scope of the existing NTCRA to include facility structure demolition to the slabs and disposition of demolition debris and 2) allow the non-process systems to remain in place and to remove these systems at the same time the building is demolished using heavy equipment such as excavators with shears.	Fieldwork in progress.			
SWMU 477/Infrastructure (C-340 Metals Plant) and SWMU 137 (C-746-A East End Smelter)	Non-time-critical removal action	May 18, 2010	Decommissioning of the C-340 Metal Plant and C-746-A East End Smelter, which entails the demolition of C-340-A, -B, and -C structures as well as the C-746-A East End Smelter. The slabs and soils underlying these structures will be addressed in future CERCLA response actions.	Fieldwork for C-746-A East End Smelter completed in FY 2010 and a Removal Action Report is currently under development. Fieldwork for C-340 is in progress.			
SWMU 480 (C-402 Lime House); SWMU 55 (C-405 Incinerator); and SWMU 464 (C-746A West End Smelter)	Non-time-critical removal action	December 5, 2005	Removed, characterized, and disposed of building structure and contents.	Complete			

AOC = area of concern

IRA = interim remedial action

KPDES = Kentucky Pollutant Discharge Elimination System

N/A = not applicable

NSDD = North-South Diversion Ditch

NTCRA = non-time-critical removal action

PGDP = Paducah Gaseous Diffusion Plant

PCB = polychlorinated biphenyl
RAWP = Remedial Action Work Plan
RDSI = remedial design/support investigation

RGA = Regional Gravel Aquifer

ROD = Record of Decision

SWMU = solid waste management unit

Tc-99 = technetium-99


TCE = trichloroethene

UCRS = Upper Continental Recharge System UST = underground storage tank

WAG = waste area group




APPENDIX 2 CERTIFICATION OF LUCIPS



CERTIFICATION OF LUCIPS


In accordance with Section 2.9 of the Land Use Control Assurance Plan for the Paducah Gaseous Diffusion Plant, Paducah, Kentucky, DOE/OR/07-1799&D2, the U.S. Department of Energy (DOE) certifies that requirements of the Land Use Control Implementation Plan for the North-South Diversion Ditch at the Paducah Gaseous Diffusion Plant, Paducah, Kentucky, DOE/OR/07-1949&D2, and the Land Use Control Implementation Plan for Interim Remedial Action for the Groundwater Operable Unit for the Volatile Organic Compound Contamination at the C-400 Cleaning Building at the Paducah Gaseous Diffusion Plant, Paducah, Kentucky, DOE/OR/07-2151&D2/R2, are being implemented by DOE at Paducah Gaseous Diffusion Plant.

There have been no changes in the designated officials identified under the Land Use Control Implementation Plan/Land Use Control Assurance Plan. There have been no major or "nonmajor" changes of land use.



APPENDIX 3

OPERABLE UNIT SCOPE DESCRIPTIONS AND KEY PROJECT ASSUMPTIONS



OPERABLE UNIT SCOPE DESCRIPTIONS AND KEY DOE PLANNING ASSUMPTIONS FROM LIFE CYCLE BASELINE

INTRODUCTION

Pursuant to Section XVIII of the Federal Facility Agreement (FFA), the following operable unit-specific descriptions document the FFA Managers' common understanding of the expected scope of work for each of the operable units (OUs) as well as U.S. Department of Energy's (DOE) key planning assumptions. The FFA Managers acknowledge that both the scope and associated assumptions may change as each project progresses; however, this appendix represents the best understanding given existing information. The milestone dates associated with executing the scope of work are defined in Appendix 5 (*Enforceable Timetables and Deadlines; Planning Dates with Long-Term Targets*). The milestone dates are based on the scope and associated assumptions described in the following sections. Schedules are based on standard Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) documentation and review/comment time frames established in the FFA. If there are deviations from the general FFA requirements, they are identified in the Key DOE Planning Assumptions from Life Cycle Baseline for each OU.

Scope and Key DOE Planning Assumptions from Life Cycle Baseline have been established based on the current understanding of site conditions and to achieve compliance with CERCLA, the National Contingency Plan (NCP), and the FFA. The actual scope of any given remedy will be developed with the U.S. Environmental Protection Agency (EPA) and the Commonwealth of Kentucky (KY) in compliance with the CERCLA process and documented in the appropriate decision document, each of which is subject to public participation in accordance with the FFA, CERCLA, and the NCP. Goals have been established for each OU to guide the development of project-specific remedial action objectives (RAOs).

Assumptions included herein are for DOE's planning purposes. While EPA and KY find the assumptions to be reasonable for bounding cost and schedule forecasts based on existing information, regulatory approval of the Site Management Plan (SMP) does not constitute approval of assumptions. In the event there is a conflict between an assumption in this SMP and an OU primary document, the OU primary document shall govern.

GROUNDWATER OPERABLE UNIT

The Groundwater Operable Unit (GWOU) is being implemented in a phased approach consisting of sequenced response actions designed to accomplish the following goals:

- (1) Prevent human exposure to contaminated groundwater;
- (2) Prevent or minimize further migration of contaminant plumes;
- (3) Prevent, reduce, or control contaminant sources contributing to groundwater contamination; and
- (4) Restore the groundwater to its beneficial uses wherever practicable.

A series of actions already have been completed toward meeting these goals, as depicted in Figure 3.1. These previous actions are summarized in Appendix 1 (*Actions Taken to Date*).

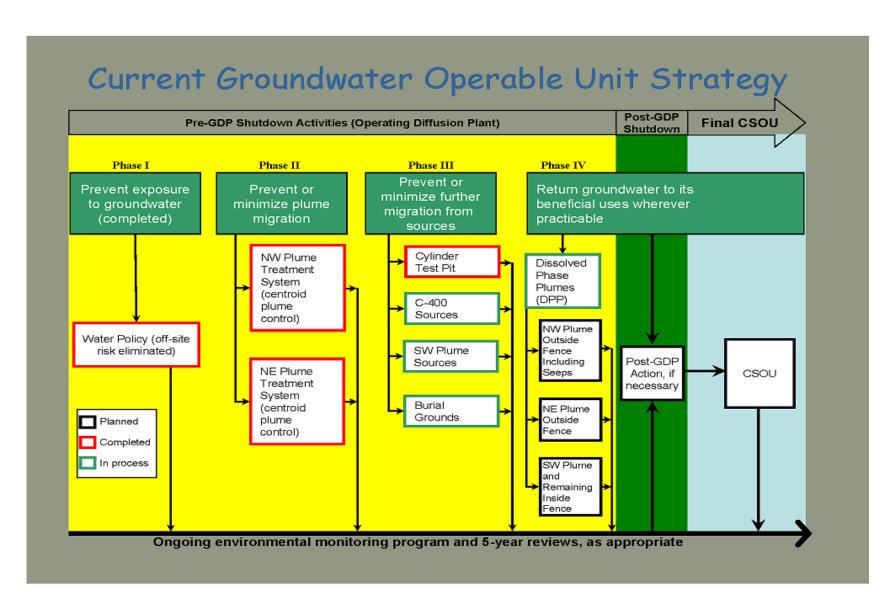


Figure 3.1. Current Groundwater Operable Unit Strategy

The scope of the GWOU consists of potential sources [e.g., dense nonaqueous-phase liquid (DNAPL) or buried wastes] that are contributing to groundwater contamination and the dissolved-phase groundwater plumes. The dissolved-phase groundwater consists of contaminated groundwater primarily in Regional Gravel Aquifer (RGA), but also includes limited areas in the Upper Continental Recharge System (UCRS) that typically are associated with source areas. An interim remedy has been selected and is being implemented for the C-400 source areas to address volatile organic compound (VOC) contamination, and a Focused Feasibility Study (FFS) has been developed for the Southwest Plume VOC source areas. The original FFS for the Southwest Plume source areas is being revised to expand the evaluation of alternatives, which will serve as a basis for a subsequent revision to the Proposed Plan. The dissolved-phase plumes will be addressed as a future response action through the remedial process.

C-400 Interim Remedial Action

Scope

This project addresses releases emanating near the southeast [Solid Waste Management Unit (SWMU) 11] and southwest (SWMU 533) areas of the C-400 Cleaning Building. These areas have been identified as the major sources of groundwater contamination at Paducah Gaseous Diffusion Plant (PGDP). The (RAOs) for this project are to do the following:

- Reduce exposure to contaminated groundwater by reducing the source concentrations of TCE and other volatile organic compounds (VOCs) in the Regional Gravel Aquifer (RGA) in the C-400 Cleaning Building area, thereby reducing the migration of these contaminants to off-site points of exposure (POE);
- Prevent exposure to contaminated groundwater by on-site industrial workers through institutional controls (e.g., excavation/penetration permit program); and
- Reduce contamination comprised of trichloroethene (TCE) and other VOCs found in Upper Continental Recharge System (UCRS) soil in the C-400 Cleaning Building area to minimize the migration of these contaminants to RGA groundwater and to off-site POE.

A major component of the selected remedy is the reduction of the concentration of TCE and other VOCs in the soils in the C-400 Cleaning Building area through removal and treatment using in both the UCRS and the RGA. Additional characterization to refine the mass estimate will be performed in the Phase II area and the parties expect a modification to the remedy in response to the Phase I results.

Final remedial action decisions addressing any residual contamination will be addressed as part of the post-gaseous diffusion plant (GDP) shutdown for GDP Groundwater Sources, as discussed in Section 3.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) Installation and operation of a three-phase ERH system. The ERH system will be operated until monitoring indicates heating has stabilized in the subsurface and recovery of TCE, as measured in the recovered vapor, diminishes to a point at which further recovery is at a constant rate (recovery is asymptotic).
- (2) Installation of a groundwater and vapor treatment system to remove VOCs from extracted vapor/groundwater.

- (3) Collection of baseline and post operational soil and groundwater samples to analyze Interim Remedial Action effectiveness. Additional groundwater monitoring will be conducted through the Environmental Monitoring Program.
- (4) Implementation of a two-phased deployment of ERH will be conducted. Phase 1 will involve treatment areas to the southwest and the east of the C-400 Cleaning Building, and Phase II will address a large treatment area to the southeast of the building.

Southwest Plume Sources Interim Remedial Action

Scope

This project will address the following three areas in the Southwest Plume: the C-747-C Oil Landfarm (SWMU 1), the areas near the southeast and northeast (SWMU 211) areas of the C-720 Building, and part of the storm sewer between the south side of the C-400 Building and Outfall 008 (SWMU 102). An FFA dispute resolution agreement specifies that a primary RAO of this action is to address these source areas, including treatment and/or removal of principal threat wastes consistent with CERCLA, the NCP (including the Preamble), and any pertinent EPA guidance. Contamination in the UCRS emanating from these sources will be addressed consistent with the FFA dispute resolution agreements. TCE and its breakdown products [cis-1,2-dichloroethene (DCE), trans-1,2-DCE, and vinyl chloride] and 1,1-DCE are the primary contaminants of concern (COCs) associated with these sources. Evaluation of a final remedial action for additional COCs associated with direct contact exposure risks will be addressed as part of the Soils OU (see Appendix 4).

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) A remedy will be implemented in source areas [i.e., Oil Land Farm (SWMU 1) and Northeast and Southeast of the C-720 Building (SWMU 211 A & B)].
- (2) Membrane Interface Probe (MIP), correlated with soil bore samples, will be conducted prior to design and remedy implementation.
- (3) No further action will be required for SWMU 102 (Plant Storm Sewer).

Dissolved-Phase Plumes Remedial Action²

Scope

This project includes conducting an RI (including a baseline risk assessment), FS, and remedy selection and implementation of any necessary response actions for the dissolved-phase groundwater contamination. The RI/FS will evaluate dissolved-phase groundwater contamination, including, but not limited to, the Northwest Plume (NW) (SWMU 201), Northeast Plume (NE) (SWMU 202), and Southwest Plume (SWMU 210), and the groundwater contamination contributing to the Little Bayou Creek seeps. The RI/FS also may determine whether any follow-up actions or modifications to response actions for the GWOU are necessary. The primary RAO for this project is based on the resolution of dispute for the Southwest Plume dated March 24, 2008, as follows:

Return contaminated groundwaters to their beneficial use(s) and attain chemical-specific applicable or relevant and appropriate requirements [e.g., maximum contaminant levels (MCLs)] and/or risk-based

² The scope and planning assumptions are consistent with the March 24, 2008, and May 20, 2010, SW Plume Dispute Resolutions.

concentrations for all identified COCs throughout the plume (or at the edge of the waste management area depending on whether the waste source is removed), consistent with CERCLA, the NCP (including the Preamble), and any pertinent EPA guidance.

Key DOE Planning Assumptions from Life Cycle Baseline

The following elements summarize DOE's key planning assumptions and are illustrated in Figure 3.2.

- (1) TCE and Tc-99 are expected to be the primary COCs that will drive the remediation approach.
- (2) Implement the following actions for the pump-and-treat systems: (a) focus groundwater extraction for the NW Plume at the south well field to maximize removal of the higher TCE concentrations, thereby reducing mass flux contributing to the off-site NW dissolved-phase plume and (b) evaluate the efficacy of optimization of the NE plume extraction system, similar to the optimization of the NW Plume extraction system to improve reductions in contaminant mass migrating downgradient of PGDP.
- (3) Conduct a technology demonstration/treatability study at Little Bayou Creek seeps to address the TCE concentrations in surface water contamination resulting from groundwater discharge. The treatability study may include testing technologies that will have broader application to other areas of the dissolved-phase plumes.
- (4) The FS for the dissolved-phase plumes will be sequenced to allow collection and incorporation of approximately 2 years post operation and maintenance monitoring data at C-400.
- (5) Data collected from the NW plume extraction system optimization; the NE plume extraction system optimization; the treatability study at the Little Bayou Creek seeps; TCE degradation study; and the groundwater flow/transport model will be used to support the RI/FS process and will be documented accordingly.
- (6) The remedial action for the dissolved-phase plumes will include the following: (a) focused mass removal technology to address "high" mass residual VOCs and Tc-99 in the RGA near source areas in the plant vicinity; (b) operation of groundwater extraction system(s) until they meet shut-down criteria established in the final dissolved-phase plume Record of Decision (ROD); and (c) *in situ* treatment (e.g., enhanced bioremediation or alternative technology) for distal lobes of dissolved-phase plumes.
- (7) The extent of dissolved-phase plume groundwater contamination is expected to be limited to those areas already defined, consisting of the Northeast Plume, Northwest Plume, and Southwest Plume.
- (8) A single RI/FS Work Plan will be developed, encompassing all components of the Dissolved-Phase Plume remedial action; however, the remedial investigations may be conducted separately and the results may be reported in three separate RI Reports—(1) Northwest Plume Outside Fence Including Seeps, (2) Northeast Plume Outside Fence, and (3) Southwest Plume and Remaining Inside Fence.
- (9) In addition to the development and submittal of three separate RI Reports, three separate Feasibility Studies, Proposed Plans, Record of Decisions, Remedial Design Work Plans, Remedial Design Reports, Remedial Action Work Plans, and Remedial Action Completion Reports also may be developed and submitted for each subproject—(1) Northwest Plume Outside Fence Including Seeps, (2) Northeast Plume Outside Fence, and (3) Southwest Plume and Remaining Inside Fence.

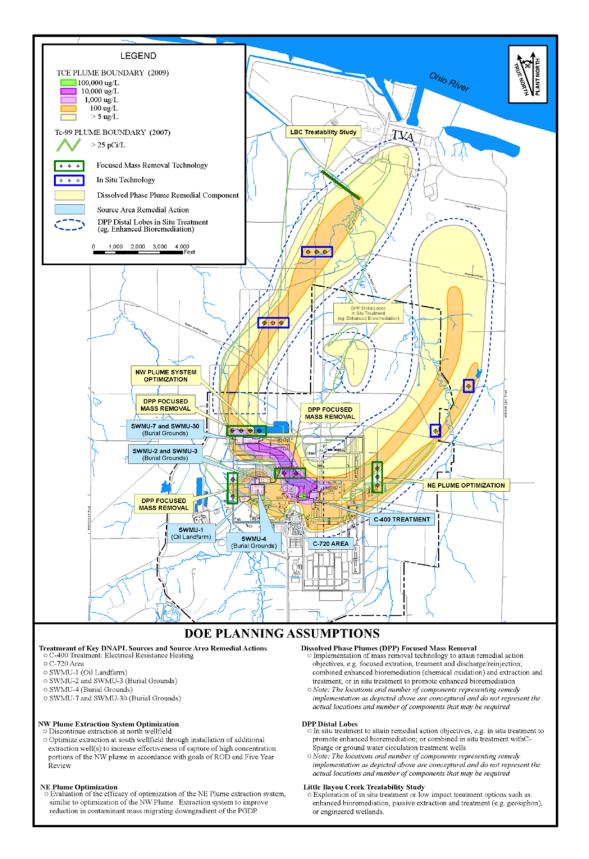


Figure 3.2. GWOU Baseline Strategy

(10) Investigation and remediation of the seep areas along Little Bayou Creek will be addressed as part of the Dissolved-Phase Plume remedial action.

BURIAL GROUNDS OPERABLE UNIT

This project currently is in dispute regarding the content of the feasibility study. The dispute resolution likely will affect the details in this section, including, but not limited to, the RAOs and planning assumptions. The dispute resolution will supercede the details in this section where appropriate and will be included in the FY 2012 SMP. The Burial Grounds Operable Unit (BGOU) will employ the CERCLA remedial process to accomplish the following goals:

- Contribute to the protection of current and future residential receptors from exposure to contaminated groundwater by addressing sources of groundwater contamination;
- Protect industrial workers from exposure to waste and contaminated soils; and
- Treat or remove principal threat wastes wherever practicable, consistent with 40 CFR § 300.430(a)(1)(iii)(A).

Scope

The BGOU consists of the following 11 SWMUs.

- C-749: Uranium Burial Ground (SWMU 2)
- C-404: Low-Level Radioactive Waste Burial Ground (SWMU 3)
- C-747/748-B: Contaminated Burial Ground (SWMU 4)
- C-746-F: Burial Ground (SWMU 5)
- C-747-B: Burial Area (SWMU 6)
- C-747-A: Burial Ground and Burn Area [SWMUs 7 and 30, which includes the area beneath the C-747-A UF₄ Drum Yard (SWMU 12)]
- Residential/Inert Borrow Area/Old North-South Diversion Ditch (NSDD) Disposal Trench (SWMU 145)
- C-746-S: Residential Landfill (SWMU 9)³
- C-746-T: Inert Landfill (SWMU 10)²
- C-746-P/P1 Scrap Yards (SWMU 13)⁴

The burial grounds contain materials such as sanitary waste, hazardous waste, radioactive waste, and pyrophoric uranium. Some of the burial grounds contain principal threat waste that have released or may

³ Previously closed under solid waste regulations (C-746-T closed on 2/9/95; C-746-S closed on 8/4/95).

⁴ The FFA parties have not reached a final decision on a path forward for SWMU 13.

in the future release to soils and groundwater. Surface soil within BGOU SWMUs is being addressed by BGOU rather than Soils OU.

An RI Report is currently under regulatory review and an FS is being conducted to support the selection of appropriate remedial actions for the burial grounds. The FFA parties are planning to accelerate implementation of SWMU 4 for an early action prior to remedy selection and implementation of remedial action for the overall BGOU. Early action of SWMU 4 is conditional based upon availability of additional funding. Additional sampling has been conducted at SWMU 13 pursuant to a D2/R1 field sampling plan, and results will be included in a Site Evaluation Report (SER). The SER will support the regulatory path forward for SWMU 13.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) Additional field investigation will be required at the C-746 P/P1 Scrap Yards (SWMU 13).³
- (2) A single FS, Proposed Plan, and ROD will be developed for all burial grounds.
- (3) SWMU 2, SWMU 3, and SWMU 4 may contain principal threat waste:
 - a. SWMU 2—excavation of buried waste; dynamic underground stripping for residual volatiles, and thermal treatment for polychlorinated biphenyls (PCBs) and uranium chip roaster to remove pyrophoric characteristics from the pyrophoric uranium;
 - b. SWMU 3—excavation of buried waste; dynamic underground stripping for residual volatiles; and
 - c. SWMU 4—excavation of buried waste; ERH treatment of secondary groundwater sources.
- (4) To facilitate phased implementation of remedial action, SWMUs 2, 3, and 4 will have an individual Remedial Design Work Plan (RDWP), Remedial Design Report (RDR), Remedial Action Work Plan (RAWP), and Remedial Action Completion Report (RACR).
- (5) Capping (18-inch soil cover) is likely for SWMUs 5, 6, 7, 30, and 145.
- (6) Capping activities assumed for SWMUs 5, 6, 7, 30, and 145 will be combined under a single RDWP, RDR, RAWP, and RACR.
- (7) Chemical oxidation will be installed in the vicinity of SWMUs 7 and 30; an independent RDWP, RDR, RAWP, and RACR will be developed for the chemical oxidation action.
- (8) No actions will be required for SWMUs 9, 10, and 13.
- (9) Post-closure monitoring data are assumed to substantiate that capping remedies will provide long-term effectiveness, and supplemental remedial actions will not be required.
- (10) An integrated groundwater monitoring system will be employed to provide indication of future unanticipated releases and collect data on the effectiveness of the caps and *in situ* actions.
- (11) No technology demonstration or treatability studies will need to be conducted.

SURFACE WATER OPERABLE UNIT

The Surface Water Operable Unit (SWOU) is being implemented in a phased approach consisting of a series of sequenced remedial and removal actions designed to accomplish the following goals:

- (1) Prevent human exposure to contaminated sediments presenting an unacceptable risk to on-site workers and off-site recreational users of surface water;
- (2) Prevent or minimize further off-site migration of contaminated sediments and surface water;
- (3) Reduce, control, or minimize contaminant sources contributing to sediment and surface water contamination; and
- (4) Evaluate and select long-term solutions for off-site surface water contamination to protect recreational users and ecological receptors.

A series of actions already have been completed toward meeting these goals, as depicted in Figure 3.3. The previous actions are summarized in Appendix 1 (*Actions Taken to Date*).

The SWOU consists of the specific SWMUs and Areas of Concern (AOCs) identified in Appendix 4 (*Source Area By Operable Unit*), and includes the soils/sediments and storm water corresponding with the points of discharge from facility piping to ditches, outfalls and Bayou and Little Bayou Creeks. Metals, radionuclides, and PCBs are the likely contaminants of interest for the SWOU. Remediation of Outfalls 005, 006, 017, and 019 and their associated ditches is planned to occur during post-GDP shutdown for the GDP Lagoons and Ditches OU unless the parties agree early action is warranted.

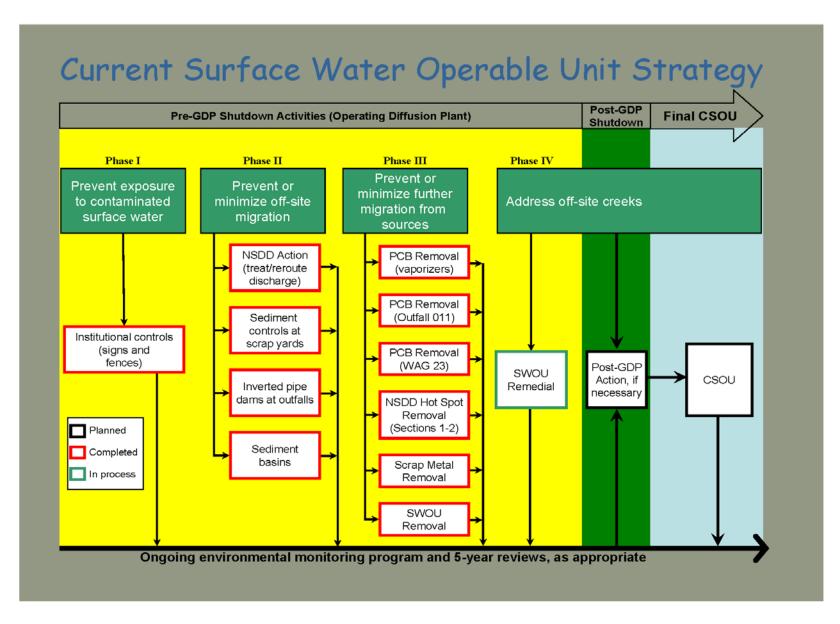


Figure 3.3. Current Surface Water Operable Unit Strategy

Surface Water Remedial Action

Scope

The scope of this project includes an RI/FS [baseline risk assessment (BRA)], remedy selection, and implementation of any necessary response actions for on- and off-site areas, including Bayou Creek, Little Bayou Creek, and Outfalls 001, 002, 008, 009, 010, 011, 012, 013, and 015, as well as scoping for and completion of a baseline ecological risk assessment for PGDP. The timing and sequence of any remedial actions will require coordination with ongoing plant operations to prevent recontamination and consideration of ongoing permitted discharges. The SWOU will address contaminated media [e.g., surface water and sediments) associated with ditches and creeks as part of the RI/FS consistent with the NCP and EPA guidance. Even though remediation of Outfalls, 005, 006, 017, and 019 and their associated ditches is not planned until after GDP shutdown, data associated with them [e.g., creek data upstream and downstream of the point of discharge, Kentucky Pollutant Discharge Elimination System (KPDES) monitoring data, and information on ecological receptors] will be included in the RI/FS and sitewide baseline ecological risk assessment associated with the SWOU during the pre-shutdown phase.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) RI characterization will be conducted in a phased approach with, uranium-238, cesium-137, and Total PCBs being used as indicator parameters during the first phase, followed by a more comprehensive list of analyte sampling (i.e., PCBs, metals, radionuclides, and volatile organic analytes during the second phase.
- (2) Existing information for internal ditches will be used for characterization. Additional sampling will focus primarily on areas between the KPDES compliance points and drainage into Little Bayou Creek and Bayou Creek.
- (3) Little and Bayou Creeks will be investigated to the confluence with the Ohio River.
- (4) Biota sampling will be required to support an ecological risk assessment for off-site portions of the SWOU.
- (5) The assumed remedial action is excavation of contaminated sediments in outfalls and creeks and will involve coordination with the U.S. Army Corps of Engineers. No O&M period is assumed to be needed to achieve RAOs.
- (6) The RI/FS Work Plan will be comprehensive, encompassing all components of the SWOU remedial action; however, the document will be divided by watershed (Little Bayou Creek and Bayou Creek) to support independent execution of sampling and documentation of results by watershed.
- (7) An ecological risk assessment will be completed for both watersheds and included within the RI/FS Report. Upon shutdown of the GDP and coordination with D&D activities, a sitewide ecological risk assessment may be necessary to determine the risk to ecological receptors from potential operational releases that might have occurred between the initial watershed-specific ecological risk assessments and shutdown of the GDP.
- (8) Individual Feasibility Studies, Proposed Plans, Record of Decisions, Remedial Design Work Plans, Remedial Design Reports, Remedial Action Work Plans, and Remedial Action Completion Reports may be developed and submitted per watershed.

(9) Investigation and remediation of the seep areas along Little Bayou Creek will be addressed as part of the Groundwater Operable Unit.

SOILS OPERABLE UNIT

The Soils OU is being implemented in a phased approach (i.e., pre-GDP Shutdown and post-GDP shutdown) consisting of remedial and removal actions to accomplish the following goals:

- Prevent human exposure to contamination presenting an unacceptable risk;
- Prevent or minimize further off-site migration; and
- Reduce, control, or minimize contaminated soil hot spots contributing to off-site contamination.

The Soils OU consists of 86 SWMUs/AOCs; three inactive facilities (SWMUs 181, SWMU 40, and SWMU 19); and the soil/rubble areas that have been identified to date. The scope of the removal action for two of the three inactive facilities has been completed, the exception being the excavation of contaminated soil at the C-403 Neutralization Tank (SWMU 40). This activity will occur after GDP shutdown as previously agreed to by the FFA Parties. The scope for the soil/rubble areas also has been completed. As a result, the 86 SWMUs/AOCs is the only scope remaining to be addressed under this OU prior to GDP shutdown.

Prior to GDP shutdown, the Soils OU will focus on accessible plant surface soils (ground surface to 10 ft below ground surface and 16 ft below ground surface in the vicinity of pipelines) not associated with PGDP operations. Following PGDP shutdown, slabs and underlying soils associated with facilities that have undergone D&D will be addressed as part of a subsequent action (e.g., post-GDP shutdown for the Soils and Slabs OU).

A series of Soils OU actions have been completed to date (See Figure 3.4). These previous actions are summarized in Appendix 1 (*Actions Taken to Date*).

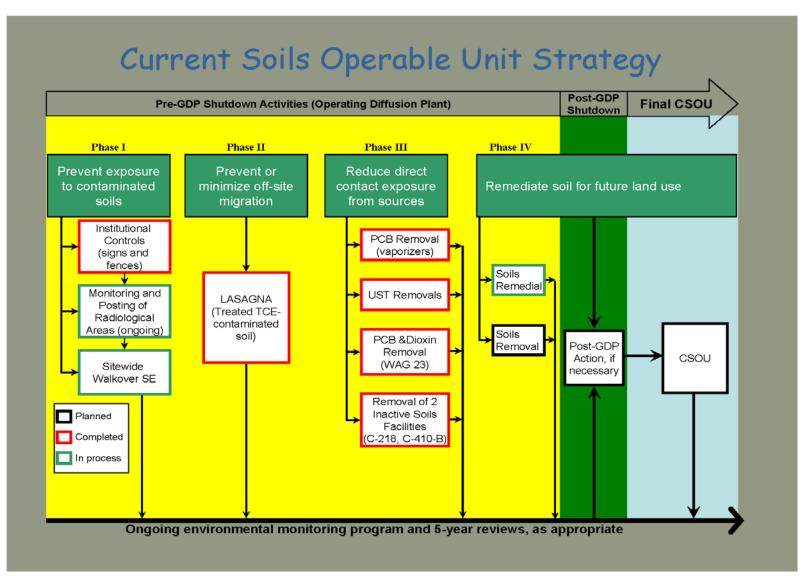


Figure 3.4. Current Soils Operable Unit Strategy

Soils OU Remedial Action (Pre-GDP Shutdown)

Scope

The scope of this project includes an RI/FS BRA, remedy selection, and implementation of any necessary response actions for the 86 SWMUs/AOCs listed in Appendix 4. Sites are included in this OU based on the expectation that they primarily pose a direct contact threat to on-site industrial workers and likely are not a migration threat to groundwater or surface water. The project will incorporate results from previous actions and sitewide evaluations/surveys. Results of the Soils OU RI will be used in scoping for and completion of the baseline ecological risk assessment conducted under the SWOU. Given the large number of SWMUs, data sets will be distributed in multiple pre-agreed upon packages to facilitate regulatory review of the RI Report.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) Radionuclides, metals, and PCBs are the primary COCs for pre-GDP shutdown. Other COCs will be considered on a case-by-case basis prior to GDP shutdown.
- (2) SWMUs requiring action will be evaluated in a single FS that will focus on the following likely response actions: no action; institutional controls; and excavation.
- (3) Three data summary packages will be developed in support of RI regulatory review with a final roll-up data summary contained in RI report.
- (4) Individual Proposed Plans, Record of Decisions, Remedial Design Work Plans, Remedial Design Reports, Remedial Action Work Plans, and Remedial Action Completion Reports may be developed and submitted per grouping. It is currently anticipated that the Soils Remedial Action may be divided into a maximum of seven groupings based upon investigation results. Once the RI data are evaluated, the proposed grouping may be adjusted.

Soils OU Removal Action

This project is contingent upon historical or new sampling results of the RI for the Soils OU Remedial Action. Scope will include addressing any of the Soils OU SWMUs/AOCs which have contaminant concentrations above early action criteria.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) A single EE/CA and Action Memorandum will be developed and submitted for those SWMUs requiring removal action.
- (2) SWMUs will be grouped into (1) outside-of-fence and (2) inside-the-fence and a Removal Action Work Plan will be developed and submitted for each grouping.
- (3) Separate Removal Action Reports may be developed and submitted for each of the two grouping.

Sitewide Evaluation

Scope

The scope of the project includes a survey of the DOE-owned property outside the limited/controlled area. A sitewide evaluation will be performed to identify any unknown contaminated areas requiring further CERCLA evaluation and to develop information usable when completing the Resource Conservation and Recovery Act Corrective Action (RCRA) Environmental Indicators process.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) A flyover rad survey has been conducted for a 25 square mile area.
- (2) A visual walkover survey covered DOE owned property that is outside the controlled area and not currently a SWMU/AOC (approximately 2,676 acres). DOE property licensed to West Kentucky Wildlife Management Area (WKWMA) and areas owned by WKWMA identified as anomalies in the flyover also will be surveyed.
- (3) Visual observation was used to identify piles, spills, buried materials, and other anomalies.
- (4) A radiological walkover survey using MARSSIM approach covered at least 10% of the property identified above (approximately 240 acres). All anomalies identified have been scanned regardless of what percentage of land they cover.
- (5) All anomalies have been documented on a map and in a database including location, description, photos, and data.
- (6) Analytical sampling has been conducted if the RAD scan indicates contamination (i.e., 2X background) or a release is visually identified.
- (7) Information will be documented in a SER. SWMU Assessment Reports will be attached to the SER for any new SWMUs/AOCs identified during this evaluation.
- (8) Any newly identified SWMUs/AOCs will be addressed in the Soils OU Remedial Action (Pre-GDP Shutdown). A separate removal action will not be performed.

D&D OPERABLE UNIT

The D&D OU consists of two phases (See Figure 3.5): 1) the DOE facilities that are currently inactive and scheduled for D&D prior to shutdown of the operating GDP, and 2) the USEC leased facilities and/or other DOE facilities planned for D&D after shutdown of the GDP. The D&D OU will employ the CERCLA removal action process to administer decommissioning activities of excess buildings (i.e., inactive with no reuse potential) that have a known or potential release of contamination to the environment. Consistent with the 1995 DOE and EPA Memorandum: *Policy on Decommissioning DOE Facilities under CERCLA*, DOE will employ the CERCLA Non-Time-Critical Removal Action framework unless the circumstances at the facilities make it inappropriate.

As part of future planning and execution of post-GDP shutdown activities, the FFA parties plan to evaluate and consider incorporation of CERCLA documentation strategies developed in 2009 to streamline the decision making process. In instances, where appropriate, DOE may decommission the facility following deactivation activities that are completed as non-CERCLA actions in accordance with

applicable regulations. The primary objective for this OU is to minimize or eliminate the potential threats to health and the environment caused by the potential uncontrolled release of hazardous substances from contaminated structures and to reduce long-term surveillance and maintenance costs.

Scope

The remaining pre-GDP shutdown scope of the D&D OU consists of the following inactive DOE facilities:

- C-410/420 Complex
 - Infrastructure removal at the C-410/420 Complex is currently ongoing as a CERCLA Non-Time-Critical Removal Action. Development of an Action Memorandum Addendum has been completed to modify and expand the scope of the existing CERCLA action to accelerate decommissioning of the facility structure.
- C-340 Complex and C-746-A East End Smelter
 - An EE/CA and Action Memorandum has been approved for the decommissioning of these two facilities is scheduled for 2009/2010 time frame.
 - The C-746-A East End Smelter is being accelerated from the outyear post-GDP shutdown phase as part of the American Recovery and Reinvestment Act (ARRA) and will be included with C-340 under a single set of CERCLA decision documents.

Decommissioning of CERCLA facilities completed to date is summarized in Appendix 1 (*Actions Taken to Date*). There is potential for additional facilities to come under DOE control prior to GDP shutdown and, as indicated in Figure 3.5, additional decommissioning will be accomplished during the post-GDP shutdown phase.

The decommissioning process includes the following activities:

- Remove facility infrastructure to the extent necessary to allow for safe and efficient demolition of the facility structure.
- Demolish facility to slab. Waste generated from the demolition will be disposed at the appropriate disposal facility based on the waste streams created.
- Decontaminate or apply fixative to stabilize any removable contamination remaining on the slabs to ensure slab is in a protective state. The "as left" conditions will be protective of the industrial worker.
- Basements and below grade structures will be filled with flowable fill or similar material to prevent accumulation and eliminate fall hazards. The fill material will be non-permanent to facilitate decommissioning, while not inhibiting future subsurface actions.

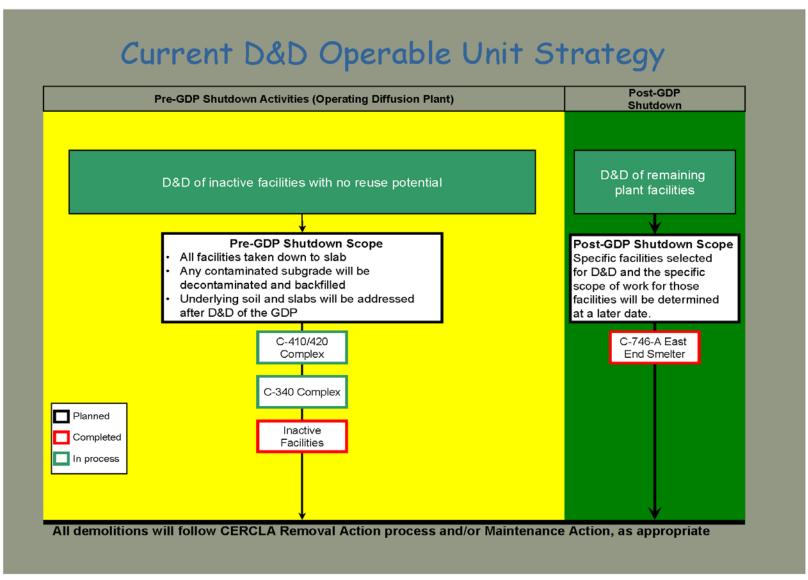


Figure 3.5. Current D&D Operable Unit Strategy

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) Slabs, subsurface structures, and underlying soils will be left and will be addressed as part of the post-GDP shutdown for the Soils and Slabs OU. No sampling of slab or sub-slab soils is planned within the scope of D&D.
- (2) Loose material, asbestos abatement, and removal of certain infrastructure and equipment typically will be conducted as part of deactivation activities as a DOE maintenance action using National Environmental Policy Act documentation.
- (3) Transite siding will be removed so that it is not present during physical demolition. Transite siding may have fixed radiological contamination.
- (4) Any RCRA-required closure actions associated with permitted facilities would be accomplished prior to D&D.

OTHER PROJECTS

CERCLA Waste Disposal Alternative Evaluation

Scope

The scope of this project is to evaluate disposal options for the CERCLA waste that will be generated as a result of implementing removal and remedial actions for all of the OUs. The evaluation of disposal options will be conducted using the CERCLA remedial decision-making process. Accordingly, the scope of the RI/FS will be focused and tailored to the nature of this project (i.e., this is not a typical project where potential releases are investigated, evaluated, and remediated). Additionally, due to significant public interest in the project, frequent interactions with the public are expected throughout the project life cycle. The decision about whether to implement an on-site disposal facility will be documented in a ROD.

Key DOE Planning Assumptions from Life Cycle Baseline

- (1) Existing information on waste types and volumes is sufficient for the RI/FS Report, and measurements of waste characteristics will not be needed for evaluation of alternatives. Assumed waste types include the following categories: low-level waste (LLW), RCRA, Toxic Substances Control Act (TSCA), LLW/RCRA, LLW/TSCA, LLW/RCRA/TSCA, classified wastes, asbestos containing materials, and non-hazardous solid (U-Landfill waste).
- (2) A potential on-site CERCLA disposal facility will not accept transuranic waste.
- (3) A combined RI/FS Report will be developed.
- (4) Sufficient information about the design, cost, and Waste Acceptance Criteria for the existing disposal facilities (e.g., Nevada Test Site, Energy *Solutions*, C-746-U Landfill) is available; no additional data collection is needed for the RI/FS Report.
- (5) Up to 12 potential locations on the Paducah Site will be evaluated in a site screening process and up to five candidate sites will be selected for evaluation in the RI/FS Report.

- (6) Post-ROD documents (i.e., design, construction, operation, and closure plans) currently are not in the DOE cost and schedule certified baseline. Implementation of the ROD⁵ may require resequencing of other site work.
- (7) Final Waste Acceptance Criteria will be defined during the post-ROD design phase.

FINAL COMPREHENSIVE SITE OPERABLE UNIT⁶


The final Comprehensive Site Operable Unit (CSOU) evaluation will occur following plant shutdown and completion of D&D of the GDP, D&D of the DUF₆ Conversion Plant, and completion of post-GDP shutdown cleanup of each of the specific OUs (e.g., GDP Groundwater Sources, Soils and Slabs). As SWMUs requiring action are completed, they will be placed in the CSOU section of Appendix 4 of the SMP to ensure that the results of the completed action are accounted for in the overall CSOU evaluation. The final CSOU will maximize use of the relevant data from previous cleanup activities and document the residual contamination and risk. Circumstances may dictate additional field activities as a result of evaluating existing information; however, it is the assumption of the FFA parties that any SWMUs entered into the CSOU will not require any additional response action. A work plan will compile and evaluate the existing information to determine if any data gaps related to conducting a sitewide evaluation exist. The RI will include a sitewide baseline human health and ecological risk assessment to evaluate residual risks and ensure all actions taken to date, when considered collectively, are protective of human health and the environment from a sitewide perspective. If the results of the final CSOU BRA conclude that overall protection of human health and the environment has been achieved, a final Proposed Plan and no further action ROD will be developed. If the BRA concludes that residual contamination still poses an unacceptable risk that exceeds the criteria established in Section XII of the FFA, a final feasibility study will be developed, followed by a final Proposed Plan, ROD, and implementation of the final remedy. DOE intends to conduct necessary long-term monitoring to evaluate progress toward achieving RAOs. When no further response is appropriate, and all the RAOs for all remedies have been achieved, PGDP will be eligible for deletion from the National Priorities List (NPL). It should be noted that partial NPL delisting may be pursued for eligible areas prior to the CSOU.

⁵ Regulatory expectations are that sufficient design and waste acceptance criteria information will be available to support the ROD.

⁶ The FFA, as currently written, contemplated multiple CSOUs, consisting of those associated with integrator units (i.e., groundwater, surface water) and a final CSOU completed after issuance of all final RODs for the site. The FFA parties acknowledge that the above scope description is intended to reflect the final CSOU, and a future FFA modification will address any inconsistencies between the FFA and SMP strategy.



APPENDIX 4 SOURCE AREA BY OPERABLE UNIT



Solid Waste Management Units/Areas of Concern by Operable Unit

			(GROUNDWATER
Operable Unit	Sul	oproject	SWMU	Description
			No.	
	C-40	00 Action	11	C-400 TCE Leak Site
		70 7 ICCIOII	533	TCE Spill Site from TCE Unloading Operations at C-400
			1	C-747-C Oil Land Farm
GWOU	Southwest		102	Plant Storm Sewer—between the south side of the C-400 Building and Outfall 008
0,400	Plum	e Sources	211 A	C-720 TCE Spill Site Northeast
			211 B	C-720 TCE Spill Site Southeast
			201	Northwest Groundwater Plume
		ssolved-	202	Northeast Groundwater Plume
	Phas	se Plumes	210	Southwest Groundwater Plume
GDP Groundwater	(C-400	11	C-400 TCE Leak Site
Sources OU		esiduals	533	TCE Spill Site from TCE Unloading Operations at C-400
Bources & C	IXC	zsidudis		URFACE WATER
	N	NSDD	59	NSDD (Inside)
	1	IDDD	58	NSDD (Outside)
			60	C-375-E2 Effluent Ditch (KPDES 002)1
			61	C-375-E5 Effluent Ditch (KPDES 013)1
			62	C-375-S6 SW Ditch (KPDES 009)1
			63	C-375-W7 Oil Skimmer Ditch (KPDES 008)
		Re	66	C-375-E3 Effluent Ditch (KPDES 010)
		Removal Action	67	C-375-E4 Effluent Ditch (C-340 Ditch
	7.0	val	68	C-375-W8 Effluent Ditch (KPDES 015)
	W	A	69	C-375-W9 Effluent Ditch (KPDES 001)
	00	ctio	92	Fill area for dirt from the C-420 PCB Spill Site
SWOU	R	On	97	C-601 Diesel Spill
51100	eme		102	Plant Storm Sewer associated with C-333-A, C-337-A, C-340,
	edia		102	C-535, and C-5371
	al A		168	KPDES Outfall Ditch 0121
	SWOU Remedial Action		526	Internal Plant Drainage Ditches
	on		64	Little Bayou Creek
			65	Bayou Creek
			93	Concrete Disposal Area East of Plant Security Area
			105	Concrete Rubble Pile (3)
			106	Concrete Rubble Pile (4)
		-	107	Concrete Rubble Pile (5)
			108	Concrete Rubble Pile (6)
			109	Concrete Rubble Pile (7)

¹ The results of the SWOU (On-Site) Site Investigation determined that there were no unacceptable levels of risk to current and anticipated future receptors that warranted inclusion of SWMU 60 (Outfall 002), SWMU 168 (Outfall 012), or SWMU 102 (PGDP storm sewer systems associated with C-333-A, C-337-A, C-340, C-535, and C-537). As a result no action will be taken for these SWMUs as originally planned under the SWOU removal action. These SWMUs will be evaluated further as part of the SWOU remedial action. It also should be noted that during development of the Sampling and Analysis Plan (SAP) for SWOU (On-Site) Removal Action, Outfall 009 and Outfall 013 were evaluated. This assessment of the outfalls, which included a review of historical data, indicated that Outfall 009 and Outfall 013 did not require an early action, and further assessment of Outfall 009 and Outfall 013 would be addressed during the Comprehensive Site Operable Unit (CSOU). Based upon current site strategy, Outfall 009 and Outfall 013 also will be addressed as part of the SWOU remedial action.

Solid Waste Management Units/Areas of Concern by Operable Unit (Continued)

5011	SURFACE WATER (CONTINUED)				
Operable Unit	Subproject	SWMU No.	Description		
SWOU		113	Concrete Rubble Pile (11)		
	SΨ	129	Concrete Rubble Pile (27)		
	SWOU Remedial Action	175	Concrete Rubble Pile (28)		
	U Ren Action	185	C-611-4 Horseshoe Lagoon		
	(en	199	Bayou Creek Monitoring Station		
	ned	205	Eastern Portion of Yellow Water Line		
	ial	549	Concrete Rubble Pile by Outfall 8		
		550	Concrete Culvert Sections, west of Outfall 001 ditch		
GDP Lagoons and Ditches OU		17	C-616-E Sludge Lagoon		
		18	C-616-F Full-Flow Lagoon		
		21	C-611-W Sludge Lagoon		
		22	C-611-Y Overflow Lagoon		
		23	C-611-V Lagoon		
		171	C-617-A Lagoons		
		Others	Outfalls 005, 006, 017, and 019 and associated ditches		
		Bi	URIAL GROUNDS		
BGOU		2	C-749 Uranium Burial Ground		
		3	C-404 Low-Level Radioactive Waste Burial Ground		
		4	C-747 Contaminated Burial Ground		
	DCOH	5	C-746-F Burial Ground		
	BGOU Remedial	6	C-747-B Burial Area		
	Kemediai	7	C-747-A Burial Ground		
		9	C-746-S Residential Landfill		
		10	C-746-T Inert Landfill		
		13	C-746-P Clean Scrap Yard (Investigation)		
		30	C-747-A Burn Area		
		145	Residential/Inert Landfill Borrow Area (P-Landfill)		
Additional Burial Ground Sources OU		472	C-746-B Pad		
		520	Scrap Material West of C-746-A		
			SOILS		
		1	C-747-C Oil Land Farm		
		11	C-400 Trichloroethylene Leak Site		
		12	C-747-A UF ₄ Drum Yard		
		13	C-746-P Clean Scrap Yard		
		14	C-746-E Contaminated Scrap Yard		
Soils OU	Soils	15	C-746-C Scrap Yard		
	Remedial	16	C-746-D Classified Scrap Yard		
		19	C-410-B HF Neutralization Lagoon		
		20	C-410-E Emergency Holding Pond ²		
		26	C-400 to C-404 Underground Transfer Line		
		27	C-722 Acid Neutralization Tank		
		31	C-720 Compressor Pit Water Storage Tank ²		

 $^{^2}$ These SWMUs are undergoing preliminary characterization as part of the Soils Operable Unit. The soils and underlying slabs associated with these SWMUs will be addressed under the Soils and Slabs OU as part of post-GDP shutdown activities.

Solid Waste Management Units/Areas of Concern by Operable Unit (Continued)

		0	S/Areas of Concern by Operable Unit (Continued) OILS (CONTINUED)
Operable Unit	Subproject	SWMU No.	Description
•	1 7	32	C-728 Clean Waste Oil Tanks ²
		47	C-400 Technetium Storage Tank Area
		56	C-540-A PCB Staging Area
		57	C-541-A PCB Waste Staging Area
		74	C-340 PCB Transformer Spill Site
		75	C-633 PCB Spill Site
		76	C-632-B Sulfuric Acid Storage Tank
		77	C-634-B Sulfuric Acid Storage Tank ²
		78	C-420 PCB Spill Site
		79	C-611 PCB Spill Site
		80	C-540-A PCB Spill Site
		81	C-541-A PCB Spill Site
		99	C-745 Kellogg Bldg. Site
		135	C-333 PCB Soil Contamination
		137	C-746-A Inactive PCB Transformer Sump Area ³
		138	C-100 Southside Berm
		153	C-331 PCB Soil Contamination (West)
		154	C-331 PCB Soil Contamination (Southeast)
		155	C-333 PCB Soil Contamination (West)
		156	C-310 PCB Soil Contamination (West Side)
		158	Chilled-Water System Leak Site
		160	C-745 Cylinder Yard Spoils (PCB Soils)
		163	C-304 Bldg./HVAC Piping System (Soil Backfill)
Soils OU	Soils	165	C-616-L Pipeline & Vault Soil Contamination
(Cont.)	Remedial	169	C-410-E HF Vent Surge Protection Tank
	(Cont.)	170	C-729 Acetylene Bldg. Drain Pits
		172	C-726 Sandblasting Facility ²
		176	C-331 RCW Leak Northwest Side
		177	C-331 RCW Leak East Side
		180	Outdoor Firing Range (WKWMA)
		181	Outdoor Firing Range (PGDP)
		194	McGraw Construction Facilities (Southside)
		195	Curlee Road Contaminated Soil Mounds
		196	C-746-A Septic System
		200	Soil Contamination South of TSCA Waste Storage Facility
		204	Dyke Road Historical Staging Area
		211 A	C-720 TCE Spill Site Northeast
		211 B	C-720 TCE Spill Site Southeast
		212	C-745-A Radiological Contamination Area
		213	OS-02
		214	OS-03
		215	OS-04
		216	OS-05
		217	OS-06
		218	$OS-07^2$
		219	OS-08
		220	$OS-09^2$

³ SWMU 137, associated with the C-746-A East End Smelter removal, is being accelerated as part of the American Recovery and Reinvestment Act (ARRA) and will utilize the CERCLA decision documents for the C-340 Complex. SWMU 137 also is being evaluated as part of pre-GDP shutdown for the Soils OU.

Solid Waste Management Units/Areas of Concern by Operable Unit (Continued)

	SOILS (CONTINUED)				
Operable Unit	Subproject	SWMU No.	Description		
- P	o and per officer	221	OS-10		
		222	OS-11		
		223	OS-12 ²		
		224	OS-13		
		225	OS-14		
		226	OS-15		
		227	OS-16		
		228	OS-17		
		229	OS-18		
		483	Nitrogen Generating Facilities ²		
		486	Rubble Pile WKWMA		
		487	Rubble Pile WKWMA		
		488	PCB Contamination Area by the C-410 Trailer Complex		
		489	Septic Tank North of C-710 Laboratory		
	Coile	492	Contaminated Soil Area, near of Outfall 010		
Soils OU	Soils Remedial	493	Concrete Rubble Piles Near Outfall 001		
(Cont.)	(Cont.)	517	Rubble and Debris Erosion Control Fill Area		
	(Cont.)	518	Field South of C-746-P1 Clean Scrap Yard		
		520	Scrap Material West of C-746-A		
		531	Aluminum Slag Reacting Area (C-746-H4) near the C-746-A Facility		
		541	Contaminated Soil Area South of Outfall 011		
		561	Soil Pile I		
		562	Soil Piles C, D, E, F, G, H, J, K, and P in subunit 1 north of Soil		
		302	Pile I on the west bank of Little Bayou Creek.		
		563	Soil Piles 20, CC, and BW in subunit 4 north of outfall 012 west		
			of Little Bayou Creek		
		564	Soil Pile AT in subunit 5 that consists of three soil areas on the		
			east side of the North-South Diversion Ditch north of the P-, S-,		
			and T-Landfills		
		565	Rubble Area KY-19 (along Bayou Creek north of C-611 Water		
			Treatment Plant)		
		567	Soil Pile K013 near Outfall 013, West of Little Bayou		
		20	C-410-E Emergency Holding Pond slab and underlying soils		
		31	C-720 Compressor Pit Water Storage Tank slab and underlying		
			soils		
		32	C-728 Clean Waste Oil Tanks slab and underlying soils		
Soils and Slabs		40	C-403 Neutralization Tank slab and underlying soils		
OU ⁴		41	C-410-C Neutralization Tank slab and underlying soils		
00		55	C-405 Incinerator building slab and underlying soils		
		77	C-643-B-Sulfuric Acid Storage Tank slab and underlying soils		
		172	C-726 Sandblasting Facility slab and underlying soils		
		218	OS-07 slab and underlying soils		
		220	OS-09 slab and underlying soils		

⁴ Only SWMUs contained in facilities located on the ground floor of the building slabs have been identified as part of this scope. Those SWMUs located on the upper floors, that are expected to be totally removed as part of the decommissioning, have not been included.

		SO	OILS (CONTINUED)
Operable Unit	Subproject	SWMU No.	Description
		223	OS-12 slab and underlying soils
		378	G-340-01 slab and underlying soils
		379	G-340-03 slab and underlying soils
		380	G-340-04 slab and underlying soils
		381 434	G-340-05 slab and underlying soils S-340-01 slab and underlying soils
		463	C-746-A East End Smelter slab and underlying soils
		464	C-746-A West End Smelter building slab and underlying soils
		469	C-745-J Yard
		470	C-746-V Yard
		474	West of Vortec Site
		477	C-340 Metals Plant building slab and underlying soils
		478	C-410/420 Feed Plant building slab and underlying soils
		480	C-402 Lime House building slab and underlying soils
		483	Nitrogen Generating Facilities slab and underlying soils
		494	Ash Receiver Area in C-410/420 slab and underlying soils
		495	C-410-I Ash Receiver Shed building slab and underlying soils
		497	C-410/420 F2 Cell Neutralization Room Vats slab and underlying soils
		498	C-410/420 Sump at Column D & E-1&2 slab and underlying soils
		499	C-410/420 Sump at Column H-9&10 slab and underlying soils
		500	C-410/420 Sump at Column U-10&11 slab and underlying soils
Soils and Slabs		501	C-410/420 UF ₆ Scale Pit Sumps A&B slab and underlying soils
OU (Cont.)		502	C-410/420 Sump at Column U-9 slab and underlying soils
(Cont.)		503	C-410/420 Sump at Column G-1 slab and underlying soils
		504	C-410/420 Sump at Column L-10 slab and underlying soils
		505	C-410/420 Sump at Column A-3N slab and underlying soils
		506	C-410/420 Sump at Column Wa-9 slab and underlying soils
		507	C-410/420 Condensate Tank Pit slab and underlying soils
		508	C-410/420 Settling Basin slab and underlying soils
		509	C-410/420 Drain pit slab and underlying soils
		510	C-410/420 Sump at Column P&Q-2 slab and underlying soils
		511	C-410/420 Sump at Column Q&R-2 slab and underlying soils
		512	C-410/420 Sump at Column R-2 slab and underlying soils
		513	C-411 Cell Maintenance Room Sump slab and underlying soils
		516	C-340 Derby Preparation Area Sludge Collection System slab and
			underlying soils
		522	C-340 Work Pit at Ground Floor Level (B-7 - B-9) slab and underlying soils
		523	C-340 Metals Plant Pit at Ground Floor at F-6 - F-11 slab and underlying soils
		524	C-340 Pickling System Sump (B-10 to B-11) slab and underlying soils
		529	C-340 Powder Plant Sump at Ground Floor Level slab and underlying soils

	DE	CONTAMINA	TION AND DECOMMISSIONING
Operable Unit	Subproject	SWMU No.	Description
		41	C-410-C Neutralization Tank
		478	C-410/420 Feed Plant
		494	Ash Receiver Area in C-410/420
		495	C-410-I Ash Receiver Shed
		496	C-410 Fluorine/Hydrogen Filters (Northeast Mezzanine)
		497	C-410 Neutralization Room Inverter Vat
		498	C-410/420 Sump at Column D&E-1&2
		499	C-410/420 Sump at Column H-9&10
	т	500	C-410/420 Sump at Column U-10&11
	Inactive	501	C-410/420 UF ₆ Scale Pit Sumps A&B
	Facilities	502	C-410/420 Sump at Column U-9
	(C-410	503	C-410/420 Sump at Column G-1
	D&D)	504	C-410/420 Sump at Column L-10
		505	C-410/420 Sump at Column A-3N
		506	C-410/420 Sump at Column Wa-9
		507	C-410/420 Condensate Tank Pit
		508	C-410/420 Settling Basin
		509	C-410/420 Drain pit
D&D OU		510	C-410/420 Sump at Column P&Q-2
Dad Ou		511	C-410/420 Sump at Column Q&R-2
		512	C-410/420 Sump at Column R-2
		513	C-411 Cell Maintenance Room Sump Pit
		101	C-340 Hydraulic System
		378	G-340-01
		379	G-340-03
		380	G-340-04
		381	G-340-05
	Inactive	434	S-340-01
	Facilities	477	C-340 Metals Plant
	(C-340	514	C-340 Magnesium Fluoride Reject Silo
	D&D)	515	C-340 "Dirty" Dust Collection System
	D&D)	516	C-340 Derby Preparation Area Sludge Collection System
		521	C-340 Saw System Degreaser
		522	C-340 Work Pit at Ground Floor Level (B-7–B-9)
		523	C-340 Metals Plant Pit at Ground Floor at F-6–F-11
		524	C-340 Pickling System Sump (B-10 & 11)
		529	C-340 Powder Plant Sump at Ground Floor Level
		28	C-712 Laboratory Equalization Tank
		33	C-712 Laboratory Equalization Tank C-728 Motor Cleaning Facility
		38	C-615 Sewage Treatment Plant
		42	C-616 Chromate Reduction Facility
		70	C-333-A Vaporizer
		71	C-337-A Vaporizer
GDP D&D OU	GDP D&D	82	C-531 Electric Switchyard
CD1 DWD 00		83	C-533 Electric Switchyard
		84	C-535 Electric Switchyard
		85	C-537 Electric Switchyard
		86	C-631 Pumphouse and Cooling Tower
		87	C-633 Pumphouse and Cooling Tower
		88	C-635 Pumphouse and Cooling Tower

	DECONTAMINATION AND DECOMMISSIONING (CONTINUED)			
Operable Unit	Subproject	SWMU No.	Description	
		89	C-637 Pumphouse and Cooling Tower	
		98	C-400 Basement Sump	
		137	C-746-A Inactive PCB Area	
		159	C-746-H3 Storage Pad	
		161	C-743-T-01 Trailer Site (Soil Backfill)	
		162	C-617-A Sanitary Water Line (Soil Backfill)	
		164	KPDES Outfall Ditch 017 (Soil Backfill)	
		166	C-100 Trailer Complex Soil Contamination	
		167	C-720 White Room Sump	
		171	C-617-A Lagoons	
		172	C-726 Sandblasting Facility	
		178	C-724-A Paint Spray Booth	
		179	Plant Sanitary Sewer System	
		192	C-710 Acid Interceptor Pit	
		198	C-410-D Area Soil Contamination	
		203	C-400 Discard Waste System	
		209	C-720 Compressor Shop Pit Sump	
		463	C-746-A East End Smelter ⁵	
		482	C-415 Feed Plant Storage Building	
		183	McGraw UST	
	DUF ₆ D&D	193	McGraw Construction Facilities (Southside Cylinder Yards)	
		194	McGraw Construction Facilities (Southside)	

⁵ The C-746-A East End Smelter is being accelerated from the out-year post-GDP shutdown phase as part of the American Recovery and Reinvestment Act (ARRA) and will utilize the CERCLA decision documents for the C-340 Complex.

	FINAL COMPREHENSIVE SITE OPERABLE UNIT				
	SWMU No.	Description			
CSOU ^{6,7}	8	C-746-K Inactive Sanitary Landfill			
CSOU	91	UF ₆ Cylinder Drop Test Area			
	100	Fire Training Area			
	PERMITTED				
	3	C-404 Low-Level Radioactive Waste Burial Ground			
	9	C-746-S Residential Landfill			
	10	C-746-T Inert Landfill			
Permitted	44	C-733 Hazardous Waste Storage Area			
Permitted	46A	C-746-Q Hazardous and Low-Level Mixed Waste Storage Facility			
	144	C-746-A Hazardous and Mixed Waste Storage Facility			
	207	C-752-A ER Waste Storage Bldg.			
	208	C-746-U Solid Waste Contained Landfill			

⁶ The FFA as currently written contemplated multiple CSOUs, consisting of those associated with integrator units (i.e., groundwater, surface water) and a final CSOU completed after issuance of all final RODs for the site. The FFA parties acknowledge that the above scope description is intended to reflect the final CSOU, and a future FFA modification will be conducted to resolve any inconsistencies between the FFA and SMP strategy.

strategy. ⁷ Historically, once an action has been completed for a particular SWMU whereby no additional active response actions are expected, such SWMUs have been placed in the CSOU for further evaluation; however, the FFA parties recognized the need to reach consensus on the criteria for assigning units to the CSOU. As a result, placement of SWMUs 8, 91, and 100 in the CSOU is provisional pending the FFA parties reaching consensus on such criteria. The FY 2011 SMP will be updated to reflect agreement by the FFA parties.

Solid Waste Management Units/Areas of Concern by Operable Unit (Continued)

	NO FURTHER ACTION ⁸				
SWMU No.	Description				
24	C-750-D UST				
25	C-750 1,000-gal Waste Oil Tank (UST)				
29	C-746-B TRU Storage Area				
34	C-746-M PCB Waste Storage Area				
35	C-337 PCB Waste Storage Area				
36	C-337 PCB Waste Staging Area				
37	C-333 PCB Waste Staging Area				
39	C-746-B PCB Waste Storage Area				
43	C-746-B Waste Chemical Storage Area				
45	C-746-R Waste Solvent Storage Area				
46	C-409 Hazardous Waste Pilot Plant				
48	Gold Dissolver Storage Tank (DMSA C400-03)				
49	C-400-B Waste Solution Storage Tank				
50	C-400-C Nickel Stripper Evaporation Tank				
51	C-400-D Lime Precipitation Tank				
52	C-400 Waste Decontamination Solution Storage Tanks				
53	C-400 NaOH Precipitation Unit				
54	C-400 Degreaser Solvent Recovery Unit				
72	C-200 Underground Gasoline Tanks				
73	C-710 Underground Gasoline Tanks				
90	C-720 Underground Petroleum Naphtha Pipe				
96	C-333 Cooling Tower Scrap Wood Pile				
103	Concrete Rubble Pile (1)				
104	Concrete Rubble Pile (2)				
110	Concrete Rubble Pile (8)				
111	Concrete Rubble Pile (9)				
112	Concrete Rubble Pile (10)				
114	Concrete Rubble Pile (12)				
115	Concrete Rubble Pile (13)				
116	Concrete Rubble Pile (14)				
117	Concrete Rubble Pile (15)				
118	Concrete Rubble Pile (16)				
119	Concrete Rubble Pile (17)				
120	Concrete Rubble Pile (18)				
121	Concrete Rubble Pile (19)				
122	Concrete Rubble Pile (20)				
123	Concrete Rubble Pile (21)				
124	Concrete Rubble Pile (22)				
125	Concrete Rubble Pile (23)				
126	Concrete Rubble Pile (24)				
127	Concrete Rubble Pile (25)				
128	Concrete Rubble Pile (26)				
130	C-611 550-gal Gasoline UST				
131	C-611 50-gal Gasoline UST				
132	C-611 2,000-gal Oil UST				
133	C-611 (unknown size) Grouted UST				
134	C-611 1,000-gal Diesel/Gasoline Tank				
136	C-740 TCE Spill Site				
139	C-746-A1 UST				
140	C-746-A2 UST				
140	0 770 122 001				

 $^{^{8}}$ A portion of the SWMUs/areas of concerns listed may not qualify as NFAs per CERCLA and may require additional characterization for radionuclides under the appropriate post-GDP shutdown OU.

Solid Waste Management Units/Areas of Concern by Operable Unit (Continued)

	NO FURTHER ACTION ⁹				
SWMU No.	Description				
141	C-720 Inactive TCE Degreaser				
142	C-750-A 10,000-gal Gasoline Tank (UST)				
143	C-750-B 10,000-gal Diesel Tank (UST)				
146	Concrete Rubble Pile (40)				
147	Concrete Rubble Pile (41)				
148	Concrete Rubble Pile (42)				
149	Concrete Rubble Pile (43)				
150	Concrete Rubble Pile (44)				
151	Concrete Rubble Pile (45)				
152	Concrete Rubble Pile (46)				
173	C-746-A Trash-Sorting Facility				
174	C-745-K Low-Level Storage Area				
184	Concrete Rubble Pile (29)				
186	C-751 Fuel Facility				
187	C-611 Septic System				
188	C-633 Septic System				
189	C-637 Septic System				
190	C-337A Sewage Treatment Aeration Tank				
191	C-333-A Sewage Treatment Aeration Tank				
197	Concrete Rubble Pile (30)				
206	C-755-A Toxic Substances Control Act Waste Storage Bldg.				
208	C-746-U Solid Waste Contained Landfill				
360	C-535				
361	C-727–90 day				
362	G-310-04				
363	G-331-03				
364	G-331-05				
365	G-333-02				
366	G-333-03				
367	G-333-04				
368	G-333-08				
369	G-333-10				
370	G-333-20				
371	G-335-01				
372	G-337-02				
373	G-337-03				
374	G-337-13				
375	G-337-14				
376	G-337-15				
377	C-337-22				
382	G-340-06				
383	G-400-01				
384	G-400-02				
385	G-409-25				
386	G-410-01				
387	C-416-01				

⁹ A portion of the SWMUs/areas of concerns listed may not qualify as NFAs per CERCLA and may require additional characterization for radionuclides under the appropriate post-GDP shutdown OU.

	NO FURTHER ACTION (CONTINUED)
SWMU No.	Description
388	C-416 Decontamination Pad
389	G-533-01
390	G-535-02
391	G-537-01
392	G-540-A-01
393	G-540-A-1-02
394	G-541-A-01
395	G-600-01
396	C-611-U-01
397	G-612-01
398	G-612-02
399	G-612-A-01
400	G-635-01
401	G-710
402	G-710-04
403	G-710-20
404	G-710-24
405	G-720-22
406	G-743-T-17-01
407	G-743-T-17-02
408	G-745-B-01
409	G-745-T-01
410	G-746-G-01
411	G-746-G-1-01
412	G-746-G-2-01
413	G-746-G-3-01
414	G-746-F-01
415	G-746-S-01
416	G-746-X-01 (PCBs)
417	G-746-X-01 (Asbestos)
418	G-748-B-01
419	G-752-C-01
420	G-752-C-02
421	G-754-01
422	G-755-A-01
423	G-755-C-01
424	G-755-T-07-01
425	G-755-T-08
426	G-755-T-2-3-01
427	G-755-T-3-1-01
428	G-755-T-3-2-01
429	S-310-04
430	S-331-02
431	S-333-12
432	S-335-09
433	S-337-11
435	S-409-100
436	S-409-20
437	S-409-40
438	S-409-60

	NO FURTHER ACTION (CONTINUED)				
SWMU No.	Description				
439	S-409-80				
440	S-410-05				
441	S-540-A-2-01				
442	S-612-01				
443	S-709-01				
444	S-709-02				
445	S-710-05				
446	S-710-06				
447	S-710-09				
448	S-710-16				
449	S-710-18				
450	S-710-32				
451	S-710-41				
452	S-710-44				
453	S-710-46				
454	S-743-T-17-01				
455	S-755-T-16-01				
456	S-755-T-16-02				
457	S-755-T-16-03				
458	S-755-T-2-3-01				
459	S-755-T-3-1-01				
460	S-755-T-3-2-01				
461	S-755-T-3-2-02				
462	S-755-T-3-2-03				
465	Yard Rubble Pile and Crushate Storage Area (G-Yard)				
466	South of Dykes Road, Pond Area				
467	Concrete Cylinder Holders Storage Area on Western Kentucky Wildlife				
	Management Area				
468	Area Northwest of Outfall 015				
471	Outside C-746-B South Storage Area				
473	C-746-B Pad, West				
475	C-745-G5-01 (Paint Enclosure)				
476	Concrete Crusher				
479	C-204 Disintegrator Building				
481	C-410-A Hydrogen Holder				
484	C-611-M Storage Tank				
485	C-611-N Sanitary Water Storage				
490	McGraw Fuel Facility Waste Oil Storage Tank				
491	Mercury Spill at the C-611 Water Treatment Plant Vault				
519	C-410 Sulfuric Acid Tank (C-634-B)				
525	Concrete Water Tower Supports (KOW)				
527	C-410 GSA/SAA at Column J-6				
528	GSA/SAA at the Northwest corner of C-745-G3 Paint Enclosure				
530	Soil and Debris Storage Area by C-745-T Yard				
532	Photographic Solution Treatment Area in the C-102 Building				
534	UST #18, within SWMU 193				
535	S-755-T08-01 (Satellite Accumulation Area at C-755, Trailer 8)				
536	Concrete Truck Washout Area				

NO FURTHER ACTION (CONTINUED)							
SWMU No.	Description						
537	S-400-001 (SAA Located Outside at the Southeast Corner of the C-400 Building)						
538	S-MST-01-01 & S-MST-01-02 (Mobile Trailer 01)						
539	S-MST-01-01 & S-MST-01-02 (Mobile Trailer 02)						
540	S-MST-01-01 & S-MST-01-02 (Mobile Trailer 03)						
542 a	G-746-B-01; S-746-B-01; S-746-B-02 (GSA/SAAs located outside C-746-A)						
542 b	G-746-A-01; S-746-A-01; S-746-A-02 (GSA/SAAs located outside C-746-A)						
543	T-746-S-01 (90 Day Storage Area)						
544	T-752-C-01 (90 Day Storage Area)						
545	C-755-T-22-01 and G-755-T-22						
546	PGDP Post 67 Diesel Fuel Spill Area						
547	PGDP Post 38 Diesel Spill Area						
548	Staging Area for Concrete Piers, Wood and Rubble North Side of C-745-B Cylinder Yard						
551	C-755-GSA-23 Located at C-755 near the East Fence Line						
552	C-760 90-Day Accumulation Area						
566	H-340-01						
568	C-340 ST-90 Boxes						
	PENDING NO FURTHER ACTION DECISION						
	TBD						
SWMUs THAT WILL BE INVESTIGATED AND REMEDIATED BY THE U.S. ARMY CORPS OF ENGINEERS ¹⁰							
94	KOW Trickling Filter and Leach Field						
95	KOW Burn Area						
157	KOW Toluene Spill Area						
182	Western Portion of Yellow Water Line						

ER = environmental remediation

GDP = gaseous diffusion plant

GSA = generator staging area HVAC = heating, ventilating, and air-conditioning

KOW = Kentucky Ordinance Works KPDES = Kentucky Pollutant Discharge Elimination System

NFA = no further action

NSDD = North-South Diversion Ditch

PCB = polychlorinated biphenyl PGDP = Paducah Gaseous Diffusion Plant

RCW = recirculating cooling water

SAA = satellite accumulation area

TBD = to be determined

TCE = trichloroethene

TSCA = Toxic Substances Control Act

UST = underground storage tank


WKWMA = West Kentucky Wildlife Management Area

 $^{^{10}}$ EPA review/approval of the CERCLA documentation associated with these SWMUs has not occurred.



APPENDIX 5

ENFORCEABLE TIMETABLES AND DEADLINES; PLANNING DATES WITH LONG-TERM TARGETS



Enforceable Timetables and Deadlines; Planning Dates with Long-Term Targets

			Enforceable timetable and deadlines ¹		Planning dates with long-term targets	
Operable Unit	Subproject	Deliverable	FY 2011-FY 2013	Out-year ⁴	for decision documents 2	Comments
GŴOU	Southwest Plume Sources	D1 Revised Focus Feasibility Study Report	1/31/11			
		D1 Proposed Plan	2/21/11			
		D1 ROD	5/16/11			D1 ROD is submitted 30 days after close of public comment period on the Proposed Plan (FFA Section XIV.D).
		D1 Remedial Design Work Plan	9/13/11			,
		D1 Remedial Design Report	10/18/12			
		D1 Remedial Action Work Plan	11/16/12			
		D1 Remedial Action Completion Report			8/05/15 ³	D1 Remedial Action Completion Report is submitted 150 days after Remedial Action is completed.
	C-400	D1 Remedial Action Completion Report	9/30/13			The milestone date of 9/30/13 assumes ERH for Phase I and Phase II. The parties expect a modification to the remedy in response to Phase I results and are currently evaluating alternatives for Phase IIb (RGA). Any change or modification to the remedy will result in a revision to the milestone. D1 Remedial Action Completion Report is submitted 150 days after Remedial Action is completed.

			Enforceable t		Planning dates with long-term targets	
Operable Unit	Subproject	Deliverable	FY 2011–FY 2013	Out-year ⁴	for decision documents ²	Comments
	NE Plume	D1 Northeast Plume ESD	3/30/12			
	NE Plume	D1 Northeast Plume Remedial Action Work Plan	3/30/12			
GWOU	Dissolved-Phase Plumes	D1 RI/FS Work Plan	9/30/13			Project scoping will consider the TCE degradation study results and completion of C-400 O&M activities.
		D1 Remedial Investigation Report			1 st Quarter 2015	
		D1 Feasibility Study Report			4 th Quarter 2015	D1 Feasibility Study is submitted 60 days after EPA and KY approve the RI Report.
		D1 Proposed Plan			2 nd Quarter 2016	D1 Proposed Plan is submitted 60 days after EPA and KY approval of the Feasibility Study.
		D1 ROD			4 th Quarter 2016	D1 ROD is submitted 30 days after close of public comment period on the Proposed Plan (FFA Section XIV.D).
		D1 Remedial Design Work Plan			4 th Quarter 2016	
		D1 Remedial Design Report			4 th Quarter 2017	
		D1 Remedial Action Work Plan			4 th Quarter 2017	

			Enforceable t and dead		Planning dates with long-term targets	
Operable Unit	Subproject	Deliverable	FY 2011-FY 2013	Out-year ⁴	for decision documents 2	Comments
GŴOU	GWOU	D1 Interim Remedial Action Completion Report		3/31/19		D1 Remedial Action Completion Report is submitted 150 days after Remedial Action is completed.
D&D OU	Disposition of Inactive Facilities at PGDP	D&D OU D1 Completion Notification Letter		9/30/17		D1 Removal Action Completion Letter will be submitted after the final removal action for the D&D OU facilities is completed.
Waste Disposal Options		D1 RI/FS Report	TBD			Dates pending dispute resolution.
		D1 Proposed Plan	TBD			D1 Proposed Plan is submitted 60 days after EPA and KY approval of the Feasibility Study. Dates pending dispute resolution.
		D1 ROD	TBD			D1 ROD is submitted 30 days after close of public comment period on the Proposed Plan (FFA Section XIV.D). Dates pending dispute resolution.
		D1 Remedial Design Work Plan	TBD			Dates pending dispute resolution.
		D1 Remedial Design Report	TBD			Dates pending dispute resolution.
		D1 Remedial Action Work Plan	TBD			Dates pending dispute resolution.
SWOU	Remedial Action (Little Bayou and Bayou Creek Watersheds)	D1 Remedial Investigation Work Plan	7/11/11			
		D1 Remedial Investigation Report			1 st Quarter 2014	

			Enforceable t		Planning dates with long-term targets	
On anable Unit	Cubana i a a 4	Delimonelle	FY 2011-FY	0-44	for decision documents ²	Commonto
Operable Unit SWOU	Remedial Action (Little Bayou and Bayou Creek Watersheds)	Deliverable D1 Feasibility Study Report	2013	Out-year ⁴	3 rd Quarter 2014	Comments D1 Feasibility Study is submitted 60 days after EPA and KY approve the RI Report.
		D1 Proposed Plan			1 st Quarter 2015	D1 Proposed Plan is submitted 60 days after EPA and KY approval of the Feasibility Study.
		D1 ROD			3 rd Quarter 2015	D1 ROD is submitted 30 days after close of public comment period on the Proposed Plan (FFA Section XIV.D).
		D1 Remedial Design Work Plan			3 rd Quarter 2015	
		D1 Remedial Design Report			3 rd Quarter 2016	
		D1 Remedial Action Work Plan			3 rd Quarter 2016	
SWOU	SWOU	D1 Remedial Action Completion Report		12/13/17		D1 Remedial Action Completion Report is submitted 150 days after Remedial Action is completed.
Soils OU	Remedial Action (Pre- GDP Shutdown)	D1 Remedial Investigation Report	7/20/11			
		D1 Feasibility Study	3/16/12			D1 Feasibility Study is submitted 60 days after EPA and KY approve the RI Report.
		D1 Proposed Plan	3/13/13			D1 Proposed Plan is submitted 60 days after EPA and KY approval of the Feasibility Study.
		D1 ROD			1 st Quarter 2014	D1 ROD is submitted 30 days after close of public comment period on the Proposed Plan (FFA Section XIV.D).
		D1 Remedial Design Work Plan			1 st Quarter 2014	

			Enforceable and dead		Planning dates with long-term targets	
Operable Unit	Subproject	Deliverable	FY 2011-FY 2013	Out-year ⁴	for decision	Comments
Soils OU	Remedial Action (Pre- GDP Shutdown)	D1 Remedial Design Report			3 rd Quarter 2015	
		D1 Remedial Action Work Plan			3 rd Quarter 2015	
Soils OU	Soils OU	D1 Remedial Action Completion Report		3/22/16		D1 Remedial Action Completion Report is submitted 150 days after Remedial Action is completed.
Soils OU	Sitewide Walkover	Sitewide Evaluation Work Plan	12/30/10			
		Site Evaluation Report	8/30/11			
BGOU	Burial Grounds Remedial Action	D1 Proposed Plan	TBD			The original milestone date for the D1 Proposed Plan was 2/28/11; however, this date was stayed as a result of dispute. Any resulting scheduled changes will be established consistent with Section XXV. D1 Proposed Plan is submitted 60 days after EPA and KY approval of the Feasibility Study.
		D1 ROD	12/16/11			This date is subject to change based upon dispute resolution, and any resulting scheduled changes will be established consistent with Section XXV. D1 ROD is submitted 30 days after close of public comment period on the Proposed Plan (FFA Section XIV.D).
		D1 Remedial Design Work Plan	3/12/12			This date is subject to change based upon dispute resolution, and any resulting scheduled changes will be established consistent with Section XXV.
		D1 Remedial Design Report			1 st Quarter 2014	
		D1 Remedial Action Work Plan			1 st Quarter 2014	

			Enforceable t and deadl		Planning dates with long-term targets	
			FY 2011-FY	4	for decision	
Operable Unit	Subproject	Deliverable	2013	Out-year ⁴	documents ²	Comments
BGOU	BGOU	D1 Remedial Action Completion		9/30/19		D1 Remedial Action Completion
		Report				Report is submitted 150 days after
						Remedial Action is completed.
BGOU	SWMU 13	D1 Site Evaluation Report	7/22/11			D1 Site Evaluation Report is due 90 days after receipt of final validated data for entry into OREIS.
NA	NA	D1 Five-Year Review			7/15/13	In accordance with the FFA, this is a date for submittal of this statutorily required document. Approval date for this document is 12/30/13.

¹ Enforceable Timetables and Deadlines are based on the planning scope assumptions contained in Appendix 3, the Southwest Plume Dispute Resolution Agreement, and funding levels. While the FFA parties find these assumptions to be reasonable for bounding cost and schedule forecasts based on existing information, approval of the assumptions does not constitute decision making for the response actions described in this table.


BGOU = Burial Grounds Operable Unit; BRA = baseline risk assessment; CERCLA = Comprehensive Environmental Response, Compensation, and Liability Act; CSOU = Comprehensive Site Operable Unit; DOE = U.S. Department of Energy; D&D = Decontamination and Decommissioning; EE/CA = engineering evaluation/cost analysis; EI = Environmental Indicators; EPA = U.S. Environmental Protection Agency; ER = environmental remediation; ESD = Explanation of Significant Differences; FFA = Federal Facility Agreement; FS = feasibility study; FY = fiscal year; GDP = gaseous diffusion plant; GSA = generator staging area; GWOU = Groundwater Operable Unit; HQ = Headquarters; HVAC = heating, ventilating, and air-conditioning; KOW = Kentucky Ordinance Works; KPDES = Kentucky Pollutant Discharge Elimination System; NFA = no further action; NSDD = North-South Diversion Ditch; O&M = operations and maintenance; OU = operable unit; PCB = polychlorinated biphenyl; PGDP = Paducah Gaseous Diffusion Plant; PP = proposed plan; RI = remedial investigation; RCW = recirculating cooling water; ROD = record of decision; SAA = satellite accumulation area; SWOU = Surface Water Operable Unit; SWMU = solid waste management unit; TCE = trichloroethene; TSCA = Toxic Substances Control Act; UST = underground storage tank; WKWMA = West Kentucky Wildlife Management Area

² Not enforceable dates. Used for planning purposes only. The parties further agree that DOE can adjust the planning dates as part of the annual SMP update without having to submit an official request or justify "good cause" in accordance with Section XXIX of the FFA.

³ This date formerly has been associated with the out-year completion date for the GWOU. A new out-year completion date for the Dissolved-Phase Plume that replaces the Southwest Plumes Sources date has been established and represents the final completion date for the GWOU for pre-GDP groundwater scope.

⁴ The out-year enforceable milestones currently are in jeopardy of being missed based upon the funding targets for the Paducah Site. The FFA Parties have agreed to leave the current out-year enforceable milestones in as placeholders with the understanding that revisions to the enforceable milestones maybe necessary under the current funding targets.

APPENDIX 6 DATA MANAGEMENT PLAN



DATA AND DOCUMENTS MANAGEMENT AND QUALITY ASSURANCE PLAN FOR PADUCAH ENVIRONMENTAL MANAGEMENT AND ENRICHMENT FACILITIES

J. R. Blewett T. L. Brindley L. K. Garner J. L. White

Prepared by
Environmental Management and Enrichment Facilities
Kevil, Kentucky 42053
Managed by
BECHTEL JACOBS COMPANY LLC
for the
U.S. DEPARTMENT OF ENERGY
Under Contract No. DE-AC05-980R22700

Blank Page

DATA AND DOCUMENTS MANAGEMENT AND QUALITY ASSURANCE PLAN APPROVALS

Approved by: U. L. Chumbler	Date:	10/5/98
D. L. Chumbler	2400	
Bechtel Jacobs Company LLC		
Quality Manager		
Approved by:	Date:	10/5/98
R. L. Foster		/ /
Bechtel Jacobs Company LLC		i .
Information Technology and Sample Manager	ment	
Approved by: R. E. Scott Bechtel Jacobs Company LLC Engineering and Technical Services	Date: _	10/5/98
Approved by: J. C. Massey Bechtel Jacobs Company LLC Paducah Manager of Projects	Date: _	p/5/98
Approved by: J. C. Hodges DOE FFA Project Manager	Date: _	10-5-98

Blank Page

PREFACE

This plan is generated to define the roles, responsibilities, and activities affecting data management, document management, and quality for data collection between the Department of Energy (DOE) and the regulatory agencies that govern the Paducah Gaseous Diffusion Plant (PGDP) Federal Facility Agreement (FFA). Pursuant to the FFA section titled "Quality Assurance/Sampling Availability/Data Management," all quality-assured data or summaries of all quality-assured data from all samples collected, analyzed, and reported shall be available no later than 30 days after the analyses have been received and validated. Further, DOE shall maintain one consolidated database for the Site which includes all data/studies generated pursuant to this agreement. To fulfill this requirement, Paducah DOE has an integrated "data system" made up of many databases managed by one organization. Electronic formats and/or hard copies of all data/studies and related documents are made available upon request.

In addition to the requirements in the Federal Facility Agreement (FFA), other agreements require a consolidated data management process:

1) Environmental Protection Agency (EPA) Hazardous and Solid Waste Amendment Permit states:

Condition I.D.9.d.—Monitoring and Records

"All environmental monitoring data collected pursuant to Part II of this Permit shall be submitted to the Regional Administrator in a consistent format, with consistent parameters and concentration units. This will facilitate collection and recording of such data in a computer data file. Within one (1) year from the effective date of the Permit, this monitoring data shall also be routinely submitted electronically and on computer disc..."

Condition II.E.3.b.—Interim Measures (IM) Reports

- "...The IM Report shall contain the following information at a minimum, (e) copies of all relevant laboratory/monitoring data, etc., in accordance with Condition I.D.9."
- Kentucky Division of Waste Management Hazardous and Solid Waste Permit states:

Condition III.E.9.a—Monitoring and Records

- "...All environmental and monitoring data collected pursuant to Part II.J and Part IV of the Permit shall be submitted to the Division, both in written and electronic format. Sampling data shall be submitted in accordance with the schedules described in this Permit."
- 3) Agreement in Principle states:
 - "...DOE will promptly furnish to Kentucky environmental monitoring data in electronic format, if available, or paper copies. DOE data reports will be released to Kentucky within 90 days after receipt from the laboratory and completion of the appropriate level of review and quality assurance/quality control (QA/QC) validation..."

Blank Page

CONTENTS

				Pag
	PRI	EFACE		v
	AC	RONYN	MS	xi
	DE	FINITIO	ONS	xiii
1.	INT	RODU	CTION	1
	1.1	PUR	POSE	1
	1.2		LICABILITY	
2.	PRO		I ORGANIZATION, RESPONSIBILITY, AND TRAINING	
	2.1 2.2	ORG ROL	ES AND RESPONSIBILITIES	1 2
		2.2.1 2.2.2		2
	2.3			2
_			INING	5
3.	QA (TIVES FOR MEASUREMENT DATA	5
	3.1 3.2	DQO:	sLYTICAL DATA CATEGORIES	6
4.	APP	LICAB	LE PROTOCOLS AND DOCUMENTS	7
5.	SAM	PLE C	USTODY	7
6.	CAL	IBRAT	ION PROTOCOLS AND FREQUENCY	7
	6.1	FIEL	D EQUIPMENT CALIBRATION PROTOCOLS AND	
	6.2	LABC	QUENCIES DRATORY CALIBRATION PROTOCOLS AND	7
7.	ANA		AL PROTOCOLS	7
8.			AL PROTOCOLS	8
0.			F DATA AND DOCUMENT FLOW	8
	8.1 8.2	INTE (GRATED DATA SYSTEM	8 11
		8.2.1 8.2.2	Initiation of Data Collection	11
		8.2.3	Historical Data Gathering	11
		J	Data Quality Criteria	12

CONTENTS (Continued)

	8.3	DATA	COLLECTION	12
		8.3.1	Station Information	12
		8.3.2	Lithologic Information	12
		8.3.3	Sample Information	12
		8.3.4	Field Measurements	12
		8.3.5	Analytical Data	13
		8.3.6	Monitoring Structure Information	13
		8.3.7	GIS Information	13
	8.4	DATA	REVIEW	13
		8.4.1	Laboratory Contractual Screening	13
		8.4.2	Data Verification	13
		8.4.3	Data Validation	14
		8.4.4	Data Assessment	14
		8.4.5	Report Preparation	14
	8.5	DATA	AND RECORDS ARCHIVAL	14
		8.5.1	Data Archival	14
		8.5.2	Records Archival	15
9.	DOC	UMEN'	Γ AND DATA RELEASE AND TRANSFER	16
	9.1		JMENT RELEASE AND TRANSFER	16
	9.2	ELEC	TRONIC DATA RELEASE AND TRANSFER	16
		9.2.1	DOE Remedial Action Investigations	16
		9.2.2	DOE-Permitted Facilities/Routine Environmental Monitoring	
			Reports	16
		9.2.3	Special Requests	16
10.	INTE	ERNAL	QC CHECKS	18
	10.1	FIELI	D QC SAMPLES	18
	10.2	ANAI	LYTICAL LABORATORY QC SAMPLES	19
11.	AUD	ITS AN	D SURVEILLANCES	19
	11.1	AUDI	TS	19
	11.2		TEILLANCES	19
12.	PRE	VENTI	VE MAINTENANCE	20

CONTENTS (Continued)

13.	SPECIFIC ROUT	TINE PROTOCOLS	20
	13.1 PRECISIO 13.2 ACCURAC 13.3 COMPLET	TENESS	21 21 22
14.	CORRECTIVE A	CTIONS AND NONCONFORMANCES	22
15.	QA REPORTS TO	O MANAGEMENT	22
16.	FIELD CHANGE	S	22
	REFERENCES		23
	APPENDIX A	PROJECT-SPECIFIC INFORMATION FOR QUALITY AND DATA ELEMENTS	A-1
	APPENDIX B	DATA DICTIONARY AND FORMATS FOR PADUCAH OREIS TRANSMITTALS	B-1

Blank Page

ACRONYMS

AIP Agreement in Principle
AR Administrative Record

ASER Annual Site Environmental Report

ASTM American Society for Testing and Materials

CERCLA Comprehensive Environmental Response, Compensation, and Liability Act

COC chain-of-custody
DOE Department of Energy

DMC Document Management Center

DMP Data Management Plan
DMS Data Management System
DQO Data Quality Objectives
EDD Electronic Data Deliverable

EMEF Environmental Management & Enrichment Facilities

EMP Environmental Monitoring Program

EMP PEMS Environmental Monitoring Program Project Environmental Measurements

System

EMP RTL Environmental Monitoring Program Ready-to-Load

EPA Environmental Protection Agency

ER PEMS Environmental Restoration Project Environmental Measurements System

ER RTL Environmental Restoration Ready-to-Load

FFA Federal Facility Agreement
GIS Geographic Information System

GW PEMS Groundwater Project Environmental Measurements System

GW RTL Groundwater Ready-to-Load

IM interim measures

NENW PEMS North East/North West Project Environmental Measurements System

NENW RTL North East/North West Ready-to-Load

OREIS Oak Ridge Environmental Information System

PC personal computer

PEMS Project Environmental Measurements System

PGDP Paducah Gaseous Diffusion Plant

QA quality assurance

QAMS Quality Assurance Management Staff

QC quality control

RCRA Resource, Conservation, and Recovery Act

SAP Sampling and Analysis Plan SMO Sample Management Office

SOW Statement of Work

SWMU Solid Waste Management Unit

VOA volatile organic analysis
VOC volatile organic compound
WAG Waste Area Grouping

WM PEMS Waste Management Project Environmental Measurements System

WM RTL Waste Management Ready-to-Load

Blank Page

DEFINITIONS

Administrative Record (AR)—Official body of documents that forms the basis of the selection of a particular response action.

Chain-of-Custody (COC)—A process used to document the transfer of custody of samples from one individual to another from collection until final disposition. A sample is under custody if:

- 1. it is in the field personnel's possession:
- 2. it is in the field personnel's view after being in their physical possession;
- 3. it was in the field personnel's physical possession and then it was secured to prevent tampering; or
- 4. it is placed in a designated secure area.

Data Backup—The process by which computerized data is copied from one electronic medium to another to guard against the loss of data.

Data Entry—The manual keying of information using data entry screens for transfer into a database.

Data Qualifiers—A set of predefined alphabetic or numeric codes applied to analytical data to signify its usability. Qualifiers pertaining to data include laboratory qualifiers, verification qualifiers, validation qualifiers, and assessment qualifiers.

Data Quality Checks—A list of quality control (QC) elements associated with a data collection activity which are evaluated during data verification and/or data validation.

Data Quality Objectives (DQO)—A set of criteria established for the collection of data. The DQO process is based on the DQO process developed by the Environmental Protection Agency (EPA), Region IV and is a planning tool based on the scientific method that clearly identifies an environmental problem; the remedial decisions to be made to address the problem; and the type, quantity, and quality of data needed to support decision making. The DQO process may be applied in modified form to any data collection activity. The DQO process balances risks with cost, in selecting the most appropriate data collection plan.

Paducah Department of Energy (DOE) Program Integrated Data System—An integrated computer system for data storage and retrieval that organizes data into tables consisting of one or more rows of information, each containing the same set of data items. Data files are cross-referenced to one another to provide flexible access so that data collection is complete, consistent, sufficiently documented, and reusable to the maximum extent possible. The Paducah DOE Program Integrated Data System is compatible with the central Oak Ridge Environmental Information System (OREIS) to comply with the Oak Ridge Federal Facilities Agreement (FFA).

Data Transfer—The exchange of data from one electronic medium to another.

Document—Writings, drawings, graphs, charts, photographs, electronic tapes, diskettes, and data compilation from which information can be obtained.

DEFINITIONS (Continued)

Document Management Center (DMC)—A location established for a targeted audience where individual documents are tracked and maintained for audit purposes. It also may be a center where collection of controlled documents is maintained. Paducah's established location is the document center at 761 Veterans Avenue, Kevil, Kentucky.

Document Management System (DMS)—A computerized system used by the DOE Program at the Paducah Gaseous Diffusion Plant (PGDP) to facilitate the electronic handling of bibliographic, file classification, and index information.

Electronic Data Deliverable (EDD)—Data that is received in electronic format either through transfer on physical media or direct communication between computerized data management systems. EDD contents must meet defined completeness, consistency, and format requirements. These criteria are defined in the Statement of Work (SOW) for each program or project.

Electronic Media—Data storage device such as diskette, disk drive, tape, or optical disk.

Field Logbooks—The primary record for field activities. They should include a description of any modifications to the protocols outlined in the work plan, field sampling plan, or health and safety plan with justifications for such modifications. They are intended to provide sufficient data and observations to enable participants to reconstruct events that occurred. All entries should be dated and signed by the data recorder and quality assured by another individual.

Historical Data—Data which was collected and managed prior to implementation of procedure PMSA-1001, "Quality Assured Data."

Metadata—Information about measurement data that helps to define data usability and associated context.

Quality Assurance (QA) and Data Management Plan (DMP)—A document written for each task that presents in specific terms the policies, organization, objectives, functional responsibilities, and specific QA/Quality Control (QC) activities designed to achieve the data quality goals.

Quality Assurance (QA) Record—A complete document that furnishes evidence of the quality of items, activities, or credentials and has been designated as a QA record. Such records are considered to be lifetime or nonpermanent records.

Protocol—A record or document utilized to provide guidance or work direction. Some examples of protocols would be procedures, SOWs, work guides, work instructions, sampling plans, etc.

Records—Books, papers, maps, photographs, machine-readable materials, or other documentary materials, regardless of physical form or characteristics, made or received by an agency of the U.S. Government under federal law or in connection with the transaction of public business. Virtually all recorded, informational materials in the custody of the government (including information held by contractors that is considered by contract to be government information), regardless of the medium (hard copy, machine-readable, microfilm, etc.), are considered government "records."

DEFINITIONS (Continued)

Sample Delivery Group—A unit used to identify a group of samples for delivery. Each Sample Delivery Group is assigned a unique ID number.

Sampling and Analysis Plan (SAP)—A plan of action developed before implementation of field activities that describes the methods and protocols for obtaining representative portions of the environment being investigated. It also describes the methods for analysis and the required parameters.

Statement of Work (SOW)—The contractual agreement between the requesting organization and the service provider. The SOW defines the scope of work, including associated QA/QC, schedules, and deliverables.

Task Files—Files maintained at the PGDP Site Office pertaining to the site mission. A Task File is required for each task and usually pertains to a single task.

Blank Page

1. INTRODUCTION

1.1 PURPOSE

This plan will be used for the Paducah Department of Energy (DOE) tasks that are involved in the collection of data. Each section of the plan was written to meet the data quality requirements set forth by the Paducah DOE Program and defined in 10 CFR 830.120 and provides a description of the programmatic elements which should occur for each task. Appendix A provides additional information concerning the quality assurance (QA) and data management aspects which are specific to the task and cannot be defined at this level. Appendix A should be completed once the task has been planned or has documented the Data Quality Objectives (DQOs). This plan, along with a completed Appendix A, will serve as the "Quality Assurance and Data Management Plan" for the task, will be provided to appropriate personnel, and will be maintained as a project record.

For the purpose of this document, Appendix A is not completed but shows the information to be completed for each task involved in the collection of data. Each task will issue the task-specific "Quality Assurance and Data Management Plan" through the designated channels.

1.2 APPLICABILITY

The requirements of this plan apply to the collection and generation of data by Paducah DOE. This plan applies to screening and definitive analytical data as defined in Section 3.2, historical data, and locationally descriptive data which includes the Geographic Information System (GIS), lithology, geophysical data, etc. Implementation for tasks is based on data collection needs and final use of the data. The requirements of this plan do not apply to data collected by the Health and Safety Program or personnel and financial data.

2. PROGRAM ORGANIZATION, RESPONSIBILITY, AND TRAINING

This information describes the basic organization, responsibility, and training requirements for tasks. Specific task plans should be developed using Appendix A as a guide to define individuals and matrix responsibilities. The task will further define training needs based on activities performed in the field.

2.1 ORGANIZATION

The DOE Project Manager and the DOE Performance Management contractor establish task scope and prioritize work to ensure the Paducah DOE Program strategic plans are accomplished. Furthermore, they serve as the primary interface to ensure that task, regulatory agency, stakeholder, and other involved organizations objectives are met. They will ensure that requirements in this plan are incorporated into various protocols and other Statements of Work (SOWs). In addition, they will ensure adequate technical support is in place for the task and that QA and safety are first priorities throughout the task life cycle.

2.2 ROLES AND RESPONSIBILITIES

The functional responsibilities of task staff members shown below relate to their involvement with the data collection and the output process. This section identifies task activities with staff members performing the work. While the descriptions are identified by title, they indicate functional responsibilities that task staff perform rather than individual staff positions.

2.2.1 Stakeholders

• DOE Project Manager

The DOE Project Manager has direct communication with the DOE Performance Management contractor Project Manager and is responsible for task oversight, overall compliance for the task, and submitting various reports to, and interfacing with, the Environmental Protection Agency (EPA) and the Commonwealth of Kentucky.

Commonwealth of Kentucky

The Commonwealth of Kentucky is the state regulatory stakeholder for the site. Activities including remedial action, enrichment facilities, and waste management of the Paducah DOE Program are reviewed, commented upon, and approved by the Commonwealth of Kentucky.

EPA, Region IV

EPA is the federal regulatory stakeholder for the Site. Activities, including remedial action, enrichment facilities, and waste management of the Paducah DOE Program are reviewed, commented upon, and approved by EPA.

• Kentucky Agreement in Principle (AIP)

The Kentucky AIP reflects the understanding and commitments between DOE and the Commonwealth of Kentucky regarding DOE's provision to provide to the Commonwealth technical and financial support for the Commonwealth's activities in environmental oversight, surveillance, remediation, and emergency-response activities. The AIP is intended to support nonregulatory activities. Its goal is to maintain an independent, impartial, and qualified assessment of the potential environmental impacts of present and future DOE activities at the Paducah Gaseous Diffusion Plant (PGDP).

• Federal Facility Agreement (FFA)

The FFA reflects the understanding and commitments between DOE, EPA, and the Kentucky Division of Waste Management regarding the comprehensive remediation of PGDP. The purpose of the FFA is to provide a set of comprehensive requirements for remediation that coordinates the cleanup provisions of both Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) and Resource, Conservation, and Recovery Act (RCRA).

2.2.2 DOE Managing and Integrating Contractor

Bechtel Jacobs Company LLC as the managing and integrating contractor is responsible for ensuring the following functions are performed either by their staff or a subcontractor.

Data Manager

The Data Manager is responsible for long-term electronic storage of data, loading Electronic Data Deliverables (EDDs), electronic verification of data, and ensuring compliance to policies and protocols relating to data management. The Data Manager has overall responsibility for the design, operations, and maintenance of the databases; ensures compatibility with central Oak Ridge Environmental Information System (OREIS); serves on the OREIS Steering Committee; reviews the system performance; determines the need for changes; authorizes changes; and oversees the electronic transfer of electronic data to external agencies. The Data Manager interfaces with the Sample Manager and the Project Data Coordinator to set up the Project Environmental Measurements System (PEMS) for each task. The Data Manager oversees the completion of task-specific Data Management Plans.

Data Requestor

The requestor may be a task lead or his designated representative, such as a technical lead, risk assessor, waste management coordinator, compliance coordinator, or other individual who determines the need for data to support decision making. The requestor is responsible for coordinating sample collection, sample analysis, data assessment, and decision making. If the requestor is a designated representative, the task lead has ultimate responsibility.

Network Administrator

The Network Administrator is responsible for implementing the system design for the Paducah DOE Program Integrated Data System platform; coordinating necessary network and personal computer (PC) maintenance; establishing user accounts to the network; and performing daily backups to system data.

Project Data Coordinator/Data Management Team

The Project Data Coordinator/Data Management Team is responsible for ensuring that the requirements relating to data management are met for the task. This includes accumulation of historical data, control of data generated by field activities or as a result of lab analyses, and storage of data as part of the task. The Project Data Coordinator ensures that all data are entered into PEMS. The Project Data Coordinator works with the Data Manager and the Sample Manager to ensure consistency throughout the task data, with other task's data, and the data systems in place. The Project Data Coordinator is responsible for data entry verification; assisting with the data evaluation and review process; data updates and deletions, as authorized by the Data Manager; and performing electronic transfer of data files from electronic data laboratory deliverables to the Paducah DOE Program Integrated Data System.

Project Manager

The Project Manager has direct responsibility for the overall task oversight, including budget, schedule, and milestones. This responsibility includes the management of strategic planning, safety, quality, task activities, and for the successful completion of task assignments within budget and on schedule. The Project Manager ensures that implementation of the QA and Data Management Programs is consistent with guidelines and ensures requirements are adhered to, as stated in this plan. The Project Manager reports to the Bechtel Jacobs Company Manager of Projects and interfaces with DOE and the task team.

Task Team

The Task Team is made up of personnel (i.e., Project Manager, Task Manager, Task Lead, Quality Engineer, Sample Manager, Data Manager, Technical Manager, Field Team Leader, and other field personnel) responsible for a specific task. The team is responsible for the data collection planning; fieldwork; sampling and analysis; data review; and decision making for a set task.

Quality Engineer

The Quality Engineer is responsible for the overall QA concerns of the data and system functions relating to a task. The Quality Engineer is involved in the planning and review of data to ensure that data quality requirements are met. The Quality Engineer is also responsible for helping prepare QA plans, work agreements, protocols, and documents to establish and implement requirements, performing assessments, providing guidance/assistance in resolving quality problems, and ensuring that corrective action is taken and appropriately documented.

Records Clerk

The Records Clerk is responsible for entering records; indexing data into Data Management System (DMS) records; indexing tables; assisting with the records storage and retrieval process; and performing data updates and deletions as authorized by the Records Manager.

Records Manager

The Records Manager is responsible for maintaining all pertinent and required records associated with operating the DMS and preserving the data; determining which records must be stored and the storage requirements; establishing a records classification, inventory, and indexing system; maintaining the DMS records indexing tables; implementing a records storage and retrieval system; and coordinating with the Data Manager and Sample Manager to establish pointers to data processing records and associated metadata (e.g., laboratory data packages, regulatory documents, QA requirements, and program plans).

Project Records Coordinator

The Project Records Coordinator is responsible for the task records. Duties include all activities relating to identification, acquisition, classification, indexing, and storage of task records related to field activities. The task records include data documentation materials; plans and protocols; and all task file requirements. Upon completion of the task, the Project Records Coordinator transmits all task files to the Paducah Document Management Center (DMC).

Release Requestor

The Release Requestor is identified as the person who requests the release of data to an external agency. This responsibility could be filled by several different roles including, but not limited to, the Task Lead or the Technical Manager.

Sample Manager

The Sample Manager is responsible for working with the Task Lead to develop specific analytical requirements for the task, interfacing with the Oak Ridge Sample Management Office (SMO) for procurement of laboratory services, contracting validation services, and coordinating contractual screening. The Sample Manager works with the task team to resolve issues identified during contractual screening or electronic data review of the data with the laboratory. The Sample Manager interfaces with the Data Manager, the Project Data Coordinator, and the task team.

Task Lead

The Task Lead is responsible for direct task coordination, issuing technical reports, and maintaining the task is on schedule and within the budget. The Task Lead coordinates all team personnel working on the task and communicates regularly with the Task Team personnel on the status of task budgets and schedules; assuring all protocols are followed; deliverables are met; and that any issues or concerns associated with the task are properly addressed. The Task Lead ensures that implementation of the QA and Data Management Programs is consistent with guidelines and ensures requirements are adhered to as stated in this plan. The Task Lead reports to the Task Manager and interfaces with the task team.

Task Manager

The Task Manager is responsible for ensuring that the proper resources are available and that personnel are appropriately trained for the assigned task. The Task Manager ensures that all requirements and protocols for the task are followed and that they are consistent with the overall mission of the Environmental Management and Enrichment Facilities (EMEF) Program. The Task Manager also ensures that implementation of the QA and Data Management Programs is consistent with guidelines and ensures requirements are adhered to as stated in this plan. The Task Manager reports to the Project Manager and interfaces with the Task Lead.

• Technical Manager/Subcontractor Technical Representative

The Technical Manager/Subcontractor Technical Representative is responsible for providing technical support and guidance to the task. This includes field observations and oversight of subcontractors, generating reports/documents, and making decisions regarding technical issues (i.e., sample locations, analytical methods, etc.).

2.3 TRAINING

Personnel assigned to the task, including field personnel and subcontractors, will be trained to perform the tasks to which they are assigned. Training requirements are defined in the task-specific SOWs and plans.

3. QA OBJECTIVES FOR MEASUREMENT DATA

QA objectives, for the purposes of this plan, apply to measurement data only. Other data (such as locationally descriptive information) is discussed in Section 8.

3.1 DQOs

DQOs are statements developed by data users to specify the quality of data from field and laboratory data collection activities to support specific decisions or regulatory actions. DQOs are qualitative and quantitative specifications that are used to design a study that will limit uncertainty to an acceptable level. The DQOs describe what data is needed, why the data is needed, and how the data will be used to address the problems being investigated. DQOs also establish numeric limits to ensure that data collected is of sufficient quality and quantity for user applications.

The DQO process is a planning tool based on the scientific method that clearly identifies a problem; the decisions to be made to address the problem; and the type, quantity, and quality of data needed to support the decision making. The DQO process may be applied in modified form to any data collection activity. The DQO process balances risks with costs in selecting the most appropriate data collection plan. When applicable, various regulatory agencies (i.e., EPA, Kentucky Department for Environmental Protection, etc.) may participate in the DQO sessions.

Specific DQOs and Sampling and Analysis Plans (SAPs) for tasks are developed per PMSA-1001 and will be documented in Appendix A.

3.2 ANALYTICAL DATA CATEGORIES

Two descriptive data categories have been specified by EPA in the *Data Quality Objectives Process for Superfund*, *Interim Final Guidance*, EPA/540/G-93/071 (EPA, 1993). These two data categories supersede the five quality control (QC) levels (Levels I, II, III, IV, and V). The two new data categories are associated with specific QA/QC elements and may be generated using a wide range of analytical methods. The type of data generated will be based on the qualitative and quantitative DQOs. The two data categories are:

Screening data—Measurements generated through the use of field- or fixed-laboratory methods in which the level of certainty in the data cannot be determined given physical evidence documenting the acquisition and analysis of the sample. Analytical methods producing field measurements or screening data include those that indicate the presence or absence of an analyte, or class of analytes, or provide a semiquantitative (estimated) result. Field measurement and other screening data include, but are not limited to, Draeger tubes; organic vapor analyses; soil gas surveys; and radiation and contamination monitoring. Screening data results must be confirmed by collecting a specified percentage of definitive data. Screening data should be used conservatively and not rule out the presence of a contaminant without some percentage of the data being confirmed by definitive data.

Definitive data—Analytical measurements for which the presence and corresponding concentration of the target analyte(s) can be determined with a known degree of certainty. The measurements are supported with appropriate physical evidence documenting the acquisition and analysis. Definitive data, in electronic form, must be supported with retrievable, but not necessarily retrieved, physical evidence in the laboratory. This evidence can include analytical results, QA/QC results, chains-of-custody (COCs), logbooks, standards information, etc.

Definitive data, or a combination of screening data, definitive confirmation, and definitive data, will be collected when the task is implemented. A minimum of ten percent of the screening samples will also be analyzed by a fixed-base laboratory using EPA SW-846 Methods (1986) to provide the required definitive data. When not available, other nationally recognized methods such as those of the American Society for Testing and Materials (ASTM), DOE, and EPA, will be used.

Applicable task documents summarize the data uses, data users, data categories, and data deliverable QC levels for each of the media and sample types that will be collected during the investigation.

4. APPLICABLE PROTOCOLS AND DOCUMENTS

Company protocols, sampling methods, administrative procedures, etc., utilize hierarchy documents that relate to data quality. Hierarchy documents such as EPA Quality Assurance Management Staff (QAMS) 005/80, Interim Guidelines and Specifications for Preparing Quality Assurance Project Plans, EPA Region 4 Environmental Investigations Standard Operating Procedures and Quality Assurance Manual, and Environmental Data Management Implementation Handbook for the Environmental Restoration Program (ES/ER/TM-88/R1) are used as flow-down documents in writing company protocols. Deviations are documented as described in Section 16. Protocols and documents applicable to the processes described will be defined in completion of Appendix A.

5. SAMPLE CUSTODY

COC is a process used to document the transfer of custody of samples from one individual to another from sample collection until final disposition. COC records are handled in accordance with applicable protocols. COC requires signature transfer of samples from sampling personnel to the sample custodians, who then transfer samples to the appropriate analytical laboratory personnel. The transfer of samples between individuals in the same work group located in the same general location (sampling or analytical) does not require a signature transfer since the integrity of the sample is maintained at all times. If the individuals are not in the same general location, a COC is required. This is accomplished by the samples being locked in a refrigerator when laboratory personnel are not available. Sample residuals are disposed of only after notification by the Task Lead that they no longer need archiving or once holding times have been exceeded. Sample custody protocols are identified in Appendix A.

6. CALIBRATION PROTOCOLS AND FREQUENCY

6.1 FIELD EQUIPMENT CALIBRATION PROTOCOLS AND FREQUENCIES

The calibration of field instruments will be checked in the field in accordance with manufacturer's specifications. Field calibration records will be documented in logbooks and/or on field data sheets. Calibration frequencies for field instruments will be defined in Appendix A.

6.2 LABORATORY CALIBRATION PROTOCOLS AND FREQUENCIES

The laboratory(ies) will use written, standard protocols for equipment calibration and frequency. These protocols are based on EPA guidance or manufacturer's recommendations and are given in the EPA-approved analytical methods. Supplemental calibration details, such as documentation and reporting requirements, are given in the laboratory QA Plan. The laboratory QA Plan will be reviewed and approved as part of the contract review process. When available, standards used for calibration will

be traceable by the National Institute of Standards and Technology. Corrective action protocols for malfunctioning equipment will be addressed in the laboratory QA Plan. Calibration records, in accordance with the laboratory QA Plan, will be maintained for each piece of measuring and test equipment and each piece of reference equipment. The records will indicate that established calibration protocols have been followed. Records of equipment use will be kept in the laboratory files.

7. ANALYTICAL PROTOCOLS

When available and appropriate for the sample matrix, SW-846 Methods will be used. When SW-846 Methods are not available or lower detection limits that are required cannot be achieved by SW-846 Methods, other nationally-recognized methods such as those of ASTM, DOE, and EPA will be used. Analytical methods, detection limits, sample preservation, holding times, and container requirements for field measurements and analytical parameters are defined during the DQO process and are incorporated in the analytical SOW for the task and applicable protocols and will be defined in Appendix A.

8. DETAILS OF DATA AND DOCUMENT FLOW

The components of data management include planning, collection, review, archival, and transmittal. Task activities follow identical paths to meet data management requirements. A flow chart (Figure 1) and narrative (Sections 8 and 9) are provided for each component of data and document flow. The Paducah DOE Program Integrated Data System is discussed first. The data system is core to each of the data management components.

8.1 INTEGRATED DATA SYSTEM

The Paducah DOE Program Integrated Data System provides a centralized system for management and storage of environmental information while allowing easy, yet controlled, access. The basis for the Paducah DOE Program Integrated Data System is to establish and maintain a program to provide the most efficient system of data collection, analysis, storage, and retrieval. DOE, as specified in the FFA, is to maintain one consolidated database for the Paducah Site. All data collected under this agreement (the FFA) is to be routinely submitted electronically in a consistent format to the stakeholders (see Section 9.2 and Appendix B). In addition, under the Kentucky AIP, AIP personnel require access to the electronic data that is maintained by the Paducah facility and its contractors. Consequently, the Paducah DOE Program Integrated Data System meets the regulatory requirements and provides Paducah EMEF with a platform to manage its data.

The Paducah DOE Program Integrated Data System is composed of integrated hardware and software to support the collection, management, analysis, and presentation of data associated with environmental restoration/remedial action, compliance, and monitoring activities at PGDP. All environmental measurements, analyses, and locationally descriptive information (e.g., GIS, lithology, and monitoring structure information), as applicable per this plan, is included. In addition, an extensive collection of descriptive and reference information about environmental tasks and permits is stored. A flow diagram for the Paducah DOE Program Integrated Data System is shown in Figure 2.


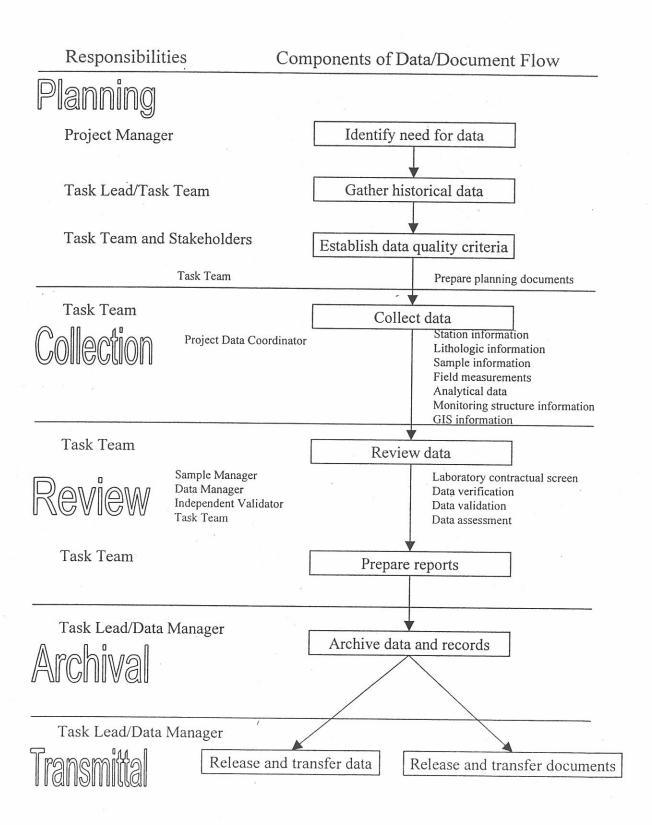


Figure 1. Detail of Data and Data Flow.

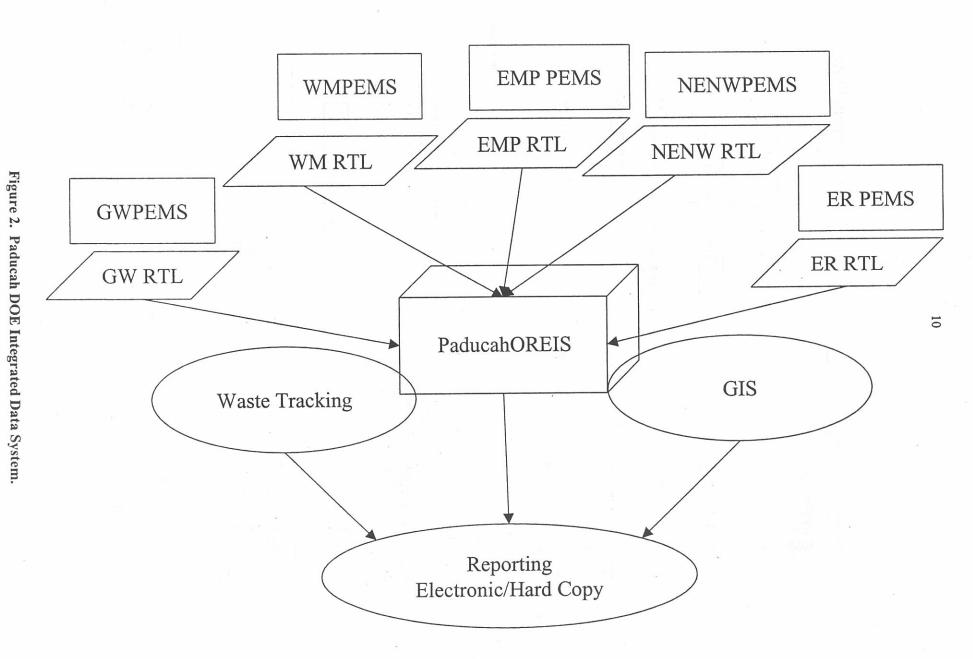

As part of the Paducah DOE Program Integrated Data System, each project utilizes a PEMS for sample scheduling, collection, and tracking each sample and associated data from point of collection through final data reporting. Each PEMS is established on a project-specific basis. PEMS tracking includes field forms, COCs, hard copy data packages, and EDDs. Project data is entered as the project progresses. All field measurement data, analytical data, lithologic descriptions, monitoring structure information, sample stations, and corresponding coordinates (as appropriate) are entered into PEMS.

Upon completion of the project, or on a routine basis, data from each PEMS is reviewed as described in Section 8.4 and transferred to Paducah OREIS for permanent retention. All final data reporting is reported from Paducah OREIS. Additionally, PEMS data is archived on a specified frequency to ensure data traceability.

The Paducah DOE Program Integrated Data System is accessed by a computer network. The system is designed to allow the electronic transfer of information between all branches of EMEF. A central file server is used to maintain the software and database applications. This server may be accessed from several PC workstations within the computer network.

8.2 DATA PLANNING

8.2.1 Initiation of Data Collection

The need for data collection is determined by the Task Lead and Project Manager to satisfy applicable regulatory requirements and/or DOE Orders. The Task Lead identifies the need for collection of data to support the task and is responsible for the development of applicable documents that outline the specific objectives of the data collection activity.

8.2.2 Historical Data Gathering

A substantial effort should be made by the data requestor (i.e., project manager/task lead) to acquire and analyze all historical data and documents relevant to the task (i.e., in numeric, spatial, attribute, and textual form) prior to the DQO process and/or data generation. For example, these documents and data might include prior work done for preliminary assessments, site characterization tasks, remedial investigations, annual monitoring reports, or data summaries provided by previous analysts. In addition, information specialists who would know of relevant documents, GIS information, and data sets should be consulted to acquire a comprehensive task background. In many cases, descriptive and qualitative information about the data (e.g., metadata) may be required. This is often the case with electronic files that may be received without the basic information provided through proper documentation. Some research may be required to prepare these metadata statements which are essential to the determination of data quality and usability.

If the data is in electronic form, the usable data and metadata should be entered into the Paducah DOE Program Integrated Data System for inclusion into Paducah OREIS. If the data is in document form, the usable data and metadata should be extracted and key-entered into the Paducah DOE Program Integrated Data System. If GIS information is required, themes/coverages should be updated as necessary.

8.2.3 Data Quality Criteria

With the usable historical data now in the Paducah DOE Program Integrated Data System, the data, along with the documents and metadata, can be retrieved, analyzed (both statistically and spatially), modeled, and used in support of DQOs for the task. This data, along with elements from the DQO process such as, contaminants of concern, QA/QC requirements, "Identification of Project Data Quality Checks" checklist, data review options, and the sampling design is used to generate applicable plans.

Field SOWs, sampling plans, and analytical SOWs are developed in support of field preparation. A field SOW describes the field activities to be undertaken and subsequent work to be performed. A sampling plan may be used to further expand on details of field activities. An analytical SOW is prepared which includes analytical parameters, methods, and detection limits. A validation SOW is also prepared when validation services are required to ensure the analytical laboratory's performance is acceptable.

Information from each of the SOWs and sampling plans is used to initiate sampling logbooks, labels, and other required field documentation. Documentation generated by the data collection activity shall be forwarded electronically and/or in hard copy to the Task Lead and the DMC to be indexed and filed as specified per the SOW.

8.3 DATA COLLECTION

Data collection information is recorded and maintained for all data collection activities. This information includes station information, lithologic information, sample information, field measurements, analytical data, monitoring structure information, and GIS information and is explained below.

8.3.1 Station Information

Station information is data describing the location from which a sample is taken. Station information includes plant coordinates (surveyed or estimated, as appropriate), station description, and station type. This information is input directly into PEMS. Methods for determining coordinates and relevant information necessary to determine and document accuracy should be recorded.

8.3.2 Lithologic Information

Lithologic information is data describing the lithology of a borehole. This information is input directly into PEMS.

8.3.3 Sample Information

Sample information is environmental data describing the sampling event and consists of the following: station, date collected, time collected, and other sampling conditions collected for every sampling event. This information is recorded in logbooks and may be included on the COC or sample labels. This information is input directly into PEMS.

8.3.4 Field Measurements

Field measurements are measurements of a parameter without physical collection of a sample which are collected real-time in the field. Field measurements may include water level measurements, pH, conductivity, flow rates, temperature, and dissolved oxygen. Field measurements are taken and recorded on appropriate field forms or in logbooks, and input into PEMS.

8.3.5 Analytical Data

The Sample Manager tracks progress of analytical samples as fieldwork continues. COCs are reviewed and lab receipt of samples is verified. Once samples have entered the laboratory, the laboratory is responsible for sample analysis, data reduction, and data reporting. The analytical data will be checked for completeness and reasonableness. A system is set up within the Paducah DOE Program Integrated Data System to log shipment of samples and receipt of data packages.

All data packages received from the fixed-base and screening/field laboratories are tracked, reviewed, and maintained in a secure environment. The primary individual responsible for these tasks is the Sample Manager. The following information is tracked: sample delivery group number, date received, number of samples, sample analyses, receipt of EDD (if applicable), and comments. The Sample Manager compares the contents of the data package with the COC form and identifies discrepancies. Discrepancies are immediately reported to the laboratory and the data validators. All data packages are forwarded to the Bechtel Jacobs Company EMEF DMC for permanent storage.

8.3.6 Monitoring Structure Information

Monitoring structure information is data describing the monitoring wells and boreholes installed during the combined tasks. Information includes well screen depth; borehole and well diameter; screened aquifer; and datum information. This information is input directly into PEMS.

8.3.7 GIS Information

GIS information is metadata that is visually descriptive of the area around the location of a project. Information may include maps of roads, streams, underground utilities, etc. Projects creating new GIS information or causing required updates to existing GIS information supply the information to the Paducah DOE Program Integrated Data System.

8.4 DATA REVIEW

8.4.1 Laboratory Contractual Screening

Laboratory contractual screening is the process of evaluating a set of data against the requirements specified in the analytical SOW to ensure that all requested information is received. The contractual screening includes, but is not limited to, the COC, number of samples, analytes requested, total number of analyses, methods used, QC samples analyzed, EDDs, units, holding times, and reporting limits achieved.

The Sample Manager conducts the screening upon receipt of data from the analytical laboratory. To the extent possible, the contractual screening should be done electronically. The Sample Manager identifies and documents any exceptions to the SOW on a Laboratory Deliverable Contractual Screening Checklist.

8.4.2 Data Verification

Data verification is the process for comparing a data set against a set standard or contractual requirement. Verification may be performed electronically, manually, or by a combination of both. Data verification includes contractual screening and can include other data quality checks established by the task team. Applicable task plans define the specific verification to be performed. Data is flagged as necessary.

Specific documentation associated with data verification is developed per PMSA-1001, Appendix G, entitled, "Identification of Project Data Quality Checks," and will be provided in Appendix A.

8.4.3 Data Validation

Data validation is the process for evaluating the laboratory adherence to analytical-method requirements. This is performed by a qualified individual for a data set, independent from sampling, laboratory, project management, or other decision-making personnel for the task. Data validation is performed according to PMSA-1001 and is coordinated by the Sample Manager. Validation qualifiers are stored in the Paducah DOE Program Integrated Data System. Documentation associated with data validation (the validation SOW, data validation reports, and exception reports, if applicable) is filed in the DMC. Specific documentation associated with data validation is identified in Appendix A.

8.4.4 Data Assessment

Data assessment is the process for assuring that DQOs are met, and that the type, quality, and quantity of data are appropriate for their intended use. It allows for the determination that a decision (or estimate) can be made with the desired level of confidence given the quality of the data set. Data assessment follows data verification and data validation and must be performed on 100 percent to ensure data is usable.

The data assessment is conducted by a designated task team member in conjunction with other task team members according to PMSA-1001. Assessment qualifiers are stored in the Paducah DOE Program Integrated Data System. Data is made available for reporting upon completion of the data assessment and associated documentation (Data Assessment Review Checklist) is filed with the task files.

8.4.5 Report Preparation

Personnel will utilize the official Paducah OREIS data tables for all official data reporting. Prior to the release of any data, the "Data Release" form shall be completed according to PMSA-1001, Appendix I. Release of all data shall be approved by DOE and the Managing and Integrating Contractor.

8.5 DATA AND RECORDS ARCHIVAL

8.5.1 Data Archival

Data archival refers to the long-term storage of electronic data generated by a task in the Paducah DOE Program Integrated Data System. Long-term storage in a central repository assures maximum accessibility by the environmental engineering community. To ensure its future usability, sufficient documentation, including the associated metadata, must accompany archived data to describe the source, contents, and structure of the data. Paducah OREIS is the database that stores archived data for future use. In addition, the Paducah PEMS used for the task is archived both intact and as exported ASCII text with sufficient documentation to recreate task data. The archive of Paducah PEMS, as well as the back-ups for Paducah OREIS, are stored in the DMC.

8.5.2 Records Archival

The DMC is a repository for all EMEF documents and data. Each EMEF task transmits a copy of all task documentation to be filed in the DMC as the task file. This information is arranged by a file classification scheme and is filed on shelves in color-coded folders. The documents are shelved in mobile file cabinets which are located inside a two-hour-rated firewall vault. The vault is protected by a wet-pipe sprinkler system and intrusion alarm. The DMC staff utilizes the DMS, a database management system designed for management and retrieval of documents, to perform searches. DMS records contain bibliographic information (title; author; issue date; document type and number; etc.), file classification information (document location), and index information (subject keywords, document status, facility name/waste area grouping [WAG]/solid waste management unit [SWMU] number, cleared for public use flag, and administrative record [AR] codes).

By utilizing the DMC, all documents relevant to EMEF work will be located in a central repository and will be available to the EMEF organization as well as other identified users. The DMC will also provide controlled access to these documents.

Information that may be found in a task file include hard copies of all original field and analytical results; data reduction and summarization programs; data packages; logbooks; associated QA/QC forms; correspondence; contracts; meeting minutes; training records; plans; and reports. All contents of a task file are classified, indexed, and stored into appropriate file groups and record series within the task file.

Satellite document centers are sometimes established with routine transfer frequencies to the PGDP DMC. Task records are maintained by the Task Records Coordinator as record copy as specified in task data and document management plans and as required by protocol. Logbooks and field documentation are copied weekly unless maintained as record copies, which are kept in one-hour-rated, fire-resistant, locked file cabinets overnight. If the activities during logbook use could potentially damage the logbook or result in loss, then weekly copies are required. If copies are made, they are maintained separate from the original logbook and are forwarded to the task files and maintained as record copy until the originals are complete. At that time, the originals replace the copies as record copy. The record copy is transferred to the Paducah EMEF DMC. Upon completion of the task, all original logbooks (field and analytical), field documentation, and project deliverables will be forwarded to the DMC by the task manager or designee.

Documents will be selected for the AR from the task file. The AR files are duplicated and made available to the public at the Environmental Information Center. Documentation associated with data and records archival includes archive checklists; indexed and filed copies of all relevant hard copies; and lists of all items recommended for the AR file.

9. DOCUMENT AND DATA RELEASE AND TRANSFER

9.1 DOCUMENT RELEASE AND TRANSFER

A standard distribution list is maintained for regulatory documents submitted according to the FFA. Changes to this distribution list should be submitted through the DOE Site Office. Other documents generated for the EMEF Program may be specially requested through the DOE Site Office or their designee. Requested documents may be historical or newly generated and will be transmitted within a reasonable time frame.

9.2 ELECTRONIC DATA RELEASE AND TRANSFER

Once data has undergone verification, validation, and data assessment, it may be released to external agencies. Routine data or data specially requested by external agencies is downloaded into a standard format (see Appendix B) and transmitted either electronically or by physical transfer on electronic media (diskettes, etc.). If data is transmitted electronically, data files will be placed on an externally-accessible file server that is password protected. The external agency has the responsibility to protect the data that has been provided. Passwords shall not be shared with anyone outside the external agency. External agencies will be notified of data availability via electronic mail.

The Task Lead/Release Requestor will complete the "Paducah EMEF Data Release to External Agencies" form and obtain all appropriate signatures. Field QC data is not routinely transmitted with the data; however, this information is available upon request. Electronic data formats will contain a "Read Me" file that will identify the electronic data package and the number of files associated with the package. The "Read Me" file will also indicate the appropriate data qualifiers along with their associated definitions and the appropriate data quality level. Hard copy data formats will contain a cover letter that will identify the contents of the data package. The cover letter will also indicate the appropriate data qualifiers along with their associated definitions and the appropriate data quality level.

9.2.1 DOE Remedial Action Investigations

DOE will provide electronically-transmitted data concurrent with the D1 Report/Characterization Report or when the Project Completion Report is issued (if formal D1 is not required) for remedial action investigations.

9.2.2 DOE-Permitted Facilities/Routine Environmental Monitoring Reports

Permitted and routine sampling is outlined in Table 8.1. Additionally, Table 8.1 includes reporting and transfer frequencies. DOE will provide electronic-transmitted data per the agreed schedule in this document.

9.2.3 Special Requests

Data will be transmitted routinely as specified in Sections 9.2.1 and 9.2.2. Any additional data generated from sampling activities that are available electronically may be transmitted upon receipt of a special request correspondence. Special requests shall be submitted through the DOE Site Office, or their designee, specifying the sampling event information required.

Table 8.1. Regulatory and routine sampling.

PROGRAM		FREQUENCIES/SCHE	DULE	
	SAMPLING	REPORTING	TRANSFER	
Permit-Associated Sampling			Total Elist Eli	
Kentucky Pollutant Discharge	Monthly and Quarterl	. IV 41	2931.5 %	
Outfalls	and Quarter	Monthly 28 th of each month	Monthly 28 th of each month	
Toxicity Monitoring	Quarterly	Quarterly	Quarterly	
Bioaccumulation Study	Annually	Publication of the ASER Annually	Concurrent with ASER Annually	
Fish Community	Semiannually	Publication of the ASER	Concurrent with ASER	
C 746 W 9 9		Annually Publication of the ASER	Annually	
C-746-K Surface Water	Quarterly	Semiannually	Concurrent with ASER Semiannually	
C-746-S&T Surface Water	Quarterly	June 30, December 30 Quarterly January 15, April 15,	June 30, December 30 Quarterly January 15, April 15,	
C-746-U Surface Water	Quarterly	July 15, October 15 Quarterly	July 15, October 15 Quarterly	
C-746-K Groundwater		January 15, April 15, July 15, October 15	January 15, April 15,	
	Quarterly	Semiannually	July 15, October 15 Semiannually	
C-404 Landfill Groundwater	Quarterly	June 30, December 30 Semiannually	June 30, December 30 Semiannually	
C-746-S&T Landfill Groundwater	Quarterly	May 30, November 30 Quarterly February 30, May 30,	May 30, November 30 Quarterly	
-746-U Groundwater Monitoring	Quarterly	August 30, November 30 Quarterly February 30, May 30	February 30, May 30, August 30, November 30 Quarterly February 30, May 30,	
nvironmental Monitoring Program	CE SEN	August 30, November 30	August 30, November 30	
	is (CIVER)			
MP Surface Water Sampling	Bimonthly	Annually Publication of Annual Site Environmental Report (ASER)	Annually Concurrent with ASER	
MP Annual Sediment Sampling	Annually	Annually	Annually	
MP Annual Deer Sampling	Annually	Publication of ASER Annually	Concurrent with ASER Annually	
ime Groundwater Sampling	Monthly and Quarterly	Publication of ASER Quarterly January 30, April 30,	November Quarterly January 30, April 30.	
sidential Groundwater Sampling	Monthly, Quarterly,	July 30, October 30 Annually	July 30, October 30 Semiannually	
veillance Groundwater Sampling	and Annually Monthly, Quarterly,	Publication of ASER Annually	April and October	
	and Annually	Publication of ASER	Semiannually January and July	

	FREQUENCIES/SCHEDULE					
PROGRAM	SAMPLING	SAMPLING REPORTING				
Surveillance & Maintenance or Ope	ration & Maintenance Ac	tivities				
C-404 Leachate	Per Permit As needed	Per Permit January 30, April 30, July 30, October 15	Annually * October 15			
C-746-S&T Leachate	Per Permit As needed	Quarterly per permit	Quarterly per permit			
C-746- U Leachate	Per Permit As needed	Quarterly per permit	Quarterly per permit			
Northwest Plume/Northeast Plume	Daily	Quarterly and Annually January 30, April 30, July 30, October 30	Quarterly January 30, April 30, July 30, October 30			

^{*} If leachate samples were collected.

10. INTERNAL QC CHECKS

10.1 FIELD QC SAMPLES

Standard operating protocols are used for all routine sampling operations. Field QC sampling will be conducted to check sampling and analytical accuracy and precision for both laboratory and field analyses of the original samples. All QC samples will be handled, shipped, and analyzed as stated in Sections 5 and 7. Field QC samples will have sample numbers which are unique and which identify them as QC samples.

A filter blank is a sample of ASTM Type II water passed through, or over, a filter before any samples are filtered. Filter blanks are used as a measure of filter contamination. Samples are analyzed for the same parameters as the filtered sample. Filter blanks can be collected at a rate of one per lot number.

Field blanks serve as a check on environmental contamination at the sample site. ASTM Type II water is transported to the site, opened in the field, transferred into each type of sample bottle, and returned to the laboratory for analysis of all parameters associated with that sampling event. It is also acceptable for field blanks to be filled in the lab, transported to the field, and then opened. Field blanks may be used as a reagent blank as needed. It is recommended that field blanks be collected at a rate of 1:20.

Equipment blanks (may also be referred to as equipment rinseates) are samples of ASTM Type II water passed through decontaminated sampling equipment. Equipment blanks are used as a measure of decontamination-process-effectiveness and are analyzed for the same parameters as the sample collected with the equipment. Equipment blanks may also be used as a reagent blank as needed. Equipment blanks are required only when nondisposable equipment is being used. It is recommended that equipment blanks be collected at a rate of 1:20.

A **trip blank** is a sample used to detect contamination by volatile organic compounds (VOCs) during sample shipping and handling. Trip blanks are 40 mL volatile organic analysis (VOA) vials of ASTM Type II water that are filled in the laboratory, transported to the sampling site, and returned to the laboratory with VOA samples. Trip blanks are not opened in the field. One trip blank is to accompany each cooler containing VOA samples. Each trip blank is to be stored at the laboratory with associated samples, and analyzed with those samples. Trip blanks are only analyzed for VOCs.

Duplicates are two separate samples taken from the same source during the same sampling event and are analyzed for the same parameters. Data generated by duplicate samples includes sampling and analytical variability (precision). It is recommended that duplicates be collected at a rate of 1:20.

10.2 ANALYTICAL LABORATORY QC SAMPLES

Fixed-based analytical laboratories that provide services will have an approved QA plan that describes the laboratory QC sample program and the laboratory control sample program. The analytical laboratory has an established internal QC program that is managed by the laboratory supervisors. Analytical laboratory QC samples will be analyzed as required by the analytical method for the parameters of interest and the results will be included in the analytical report. Blind samples are samples in which the laboratory has no information on the sample location and, subsequently, would have no indication of the possible analytical results. These samples will be analyzed for the parameters of interest and the results will be included in the analytical report. Acceptable completion of the blind samples provides an indication of the laboratory's performance. DOE laboratories participating in the blind sample program will follow blind submittal frequencies determined by the SMO.

11. AUDITS AND SURVEILLANCES

11.1 AUDITS

Audits are qualitative reviews of task activity to check that the overall QA program is functioning. Audits should be conducted early in the task so that problems can be corrected quickly. The audit involves the review of all available and relevant task and contract documents and includes an evaluation of QC measures for office and field. Audits will be performed as requested by management.

11.2 SURVEILLANCES

Surveillances follow the same general format as an audit but are less detailed and require a less formal report. A surveillance is designed to give task staff rapid feedback concerning QA compliance and to facilitate corrective action. Surveillances will be performed as requested by management.

12. PREVENTIVE MAINTENANCE

Equipment is an inclusive term for tools, gauges, instruments, and other items. The equipment discussed in this section requires that specific preventive maintenance is serviced as specified by the manufacturer's recommended schedule. All services are documented and performed by qualified and trained individuals. Out-of-service equipment is controlled to prevent inadvertent use and its maintenance is recorded. A list is maintained of the critical, spare parts that should be stocked to minimize equipment downtime. Specific field equipment preventive-maintenance practices, frequencies, and spare parts are described in the factory manual for each instrument.

Preventive-maintenance protocols for laboratory equipment and instruments are provided in laboratory QA plans. All maintenance activities will be recorded in maintenance logs. Laboratories will be required to maintain an adequate inventory of spare parts and consumables to prevent downtime as a result of minor problems.

13. SPECIFIC ROUTINE PROTOCOLS

The precision, accuracy, and completeness parameters are quantitative tools by which data sets can be evaluated. These parameters can help ensure that DQOs are met and are defined as follows:

- Precision—A quantitative measurement of the variability of a group of measurements as compared to their average. Usually expressed as a percentage or a standard deviation, it evaluates the reproducibility of the system. Sample duplicates measure the reproducibility of the sampling event, while lab replicates measure the precision of the analytical process. The acceptable precision may be defined by the laboratory method used.
- Accuracy—A quantitative measurement of the bias of the data. It represents how close the measurement data is to the true value. Analytical accuracy is measured by percent recoveries associated with the laboratory analytical control spikes (blank spikes), surrogate spikes, or matrix spikes. The acceptable accuracy may be defined by the laboratory method used. Sampling accuracy can be assessed by evaluating field and trip blanks.
- Representativeness—A qualitative measurement of the ability of a sample or group of data to adequately describe or define the conditions being measured. Precision, accuracy, and completeness all affect representativeness. Sampling strategy (location, method, and frequency) are critical to ensure that the samples statistically represent the population. Laboratory precision and accuracy reflect how representative the data is of the sample.
- <u>Completeness—A</u> quantitative measurement of the percentage of acceptable data as compared to the number planned. Both sampling and analytical completeness can be measured.
- <u>Comparability</u>—A qualitative measurement of the confidence with which one data set can be compared with another. Comparability is achieved by using standard techniques for collection and analysis.

Protocols for assessing the precision, accuracy, and completeness are provided in the following text. It should be noted that there are no standard guidelines available for representativeness and comparability.

13.1 PRECISION

To determine the precision of the laboratory analysis, a routine program of replicate analyses, in accordance with the analytical method requirements, is performed by the laboratory. The results of replicate analyses are used to calculate the relative percent difference which is used to assess laboratory precision.

For replicate results C_1 and C_2 :

Relative percent difference =
$$\frac{\left|C_1 - C_2\right|}{\left(\frac{C_1 + C_2}{2}\right)} \times 100$$

Precision of the total sampling and analytical measurement process will be assessed from field duplicates. Although a quantitative goal cannot be set due to sample variability, the Task Lead will review relative percent difference values of field duplicates to estimate precision. Analytical precision can be measured separately from sampling precision through the use of laboratory duplicate and matrix spikes.

13.2 ACCURACY

To determine the accuracy of an analytical method and/or the laboratory analysis, a periodic program of sample spiking is conducted (minimum one spike and one spike duplicate per 20 samples). The results of sample spiking are used to calculate the QC parameter for accuracy evaluation, the percent recovery (% R).

For surrogate spikes and QC samples:

$$\%R = \frac{C_s}{C_t} \times 100$$

where--

C_s = measured spiked sample concentration (or amount)

 C_t = true spiked concentration (or amount)

For matrix spikes:

$$\%R = \frac{|C_s - C_o|}{C_t} \times 100$$

where--

 C_s = measured, spiked sample concentration

 C_o = sample concentration (not spiked)

 C_t = true concentration of the spike

Accuracy of the total sampling and analytical measurement process will not be determined. This would require the addition of chemical-spiking compounds to the samples in the field.

13.3 COMPLETENESS

To determine the completeness of data, the percentage of valid, viable data obtained from a measurement system is compared with the number of total measurements. The goal of completeness is to generate a sufficient amount of valid data to satisfy task needs.

Completeness, C, is calculated as follows:

% C = $\frac{\text{Number of valid measurements}}{\text{Number of total measurements}} \times 100$

14. NONCONFORMANCES AND CORRECTIVE ACTIONS

Nonconforming equipment, items, activities, conditions, and unusual incidents that could affect compliance with task requirements will be identified, controlled, and reported in a timely manner. Nonconforming equipment will immediately be labeled or tagged, and segregated, if possible. Specific protocols for controlling nonconforming items will be described in applicable documents. Nonconformance Reports issued as a result of an audit or surveillance will identify the root cause of the problem. Laboratories must notify the appropriate personnel of any nonconformance or problems with analytical samples. Laboratory corrective actions reports are completed by the analytical laboratory when a nonconformance is recognized by laboratory personnel. Handling of any nonconformance is described in appropriate plans and protocols.

Corrective actions to audit/surveillance findings and nonconformances are managed. The Task Manager is notified of a nonconformance and/or surveillance finding. These are documented and a copy is furnished to the Task Lead as soon as possible. Copies of audits, surveillances, and/or nonconformances and their dispositions will be forwarded to the appropriate management personnel and will be placed in the DMC.

15. QA REPORTS TO MANAGEMENT

Upon request, QA personnel will provide to management a report which summarizes QA activities for the task, system, and performance audits conducted (internal and external); quality problems found; corrective actions initiated; and other applicable items. Some reports that present measurement data generated during the work assignment may require a QA section addressing the quality and limitations of the data. This QA section will address results of audits or surveillance of the measurement work; quality problems found and corrective actions taken; and deviations from applicable documents.

16. FIELD CHANGES

Field changes will be governed by control measures commensurate with those applied to the documentation of the original protocol. The task team identifies, documents, and approves field changes. These changes are communicated to the team through the use of Change Notices and Change Orders.

REFERENCES

- 10 CFR 830.120, "Quality Assurance," April 1994.
- Bechtel Jacobs Company LLC. Quality Assurance Program Plan, DRAFT, October 1998.
- Energy Systems. Environmental Measurements Data Management Plan Implementation Handbook for the Environmental Restoration Program, ES/ER/TM-88/R1, 1996.
- EPA. Data Quality Objectives Process for Superfund, Interim Final Guidance, EPA/540/G-93/071, 1993.
- EPA. Hazardous and Solid Waste Amendment Permit, Permit #KY8890008982, August, 19, 1991.
- EPA. Interim Guidelines and Specifications for Preparing Quality Assurance Project Plans, QAMS 005/80, December 20, 1980.
- EPA. Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW-846, 1986.
- EPA. EPA Region 4 Environmental Investigations Standard Operating Procedures and Quality Assurance Manual, May 1996.
- Kentucky Division of Waste Management Hazardous Waste Management Permit, Permit No. KY8890008982, August 19, 1991.
- Kentucky Agreement in Principle, January 1, 1997.
- Quality Assured Data, PMSA-1001, Bechtel Jacobs Company LLC Procedures Manual, April 1997.

APPENDIX A

TASK-SPECIFIC INFORMATION FOR QUALITY AND DATA ELEMENTS

TASK-SPECIFIC INFORMATION FOR QUALITY AND DATA ELEMENTS

Purpose and Introduction

This plan can be used and implemented for the Paducah DOE tasks requiring the collection of analytical data. Each section of the FFA QA/DMP was written to meet data-quality requirements and provides a description of the programmatic elements which should occur for each task. This appendix provides additional information concerning the QA and Data Management aspects which are specific to the task and cannot be defined at the programmatic level. This appendix should be completed once the task has been planned or once the DQOs have been documented. This completed appendix, along with the "Data and Documents Management and Quality Assurance Plan for the Paducah Environmental Management and Enrichment Facilities Program," will serve as the "Quality Assurance and Data Management Plan" for the task, will be provided to appropriate personnel, and will be maintained as a task record.

For the purpose of this document, this appendix is not completed but shows the information to be completed for each task involved in the collection of analytical data. This appendix should be completed, printed with attachments compiled, combined with the "Data and Documents Management and Quality Assurance Plan for the Paducah Environmental Management and Enrichment Facilities Program," and distributed to the appropriate personnel for review, approval, and use.

INSTRUCTIONS FOR COMPLETING THE QUALITY ASSURANCE/DATA MANAGEMENT PLAN (QA/DMP)

Use the following instructions to complete each section for the task-specific QA/DMP. Attachments may be used to serve as and/or supplement the information provided in the tables.

TITLE PAGE: Type over the task-specific information in the underlined/bolded/italicized portion of the text. Information needed is the issue date, document number, document title, and author(s). Document numbers must be obtained from the Records Manager.

APPROVAL PAGE: Type over the task-specific information in the underlined/bolded/italicized portion of the text. Information needed is the preparers' names and titles and the approvers' names and titles. Minimum approvals are the Task Lead, Project Manager, and QA Manager.

TABLE OF CONTENTS AND ATTACHMENTS: Include the appropriate page numbers to the table of contents and identify and document the attachments provided to supplement this QA/DMP.

SECTION 1.0—TASK ORGANIZATION, RESPONSIBILITY, AND TRAINING: Identify the task organizational chart listing additional roles and responsibilities, including those identified in Section 2.2 of the "Data and Documents Management and Quality Assurance Plan for the Paducah Environmental Management and Enrichment Facilities Program." Also, document in Table 1.1 the training requirements for key personnel. An organizational chart and/or training matrix may be attached to this QA/DMP.

SECTION 2.0—DATA QUALITY OBJECTIVES (DQOs) AND SAMPLE PLANNING: Refer to PMSA-1001, Quality Assured Data, Appendix C, for directions to complete DQOs for the project. Attach DQO documentation to this QA/DMP. Using the DQO documentation, with assistance from the task team, identify details of the SAP. The SAP is generated out of the data needs identified in the DQOs and will specify applicable samples (i.e., regular samples, QC samples, and waste characterization samples) to be collected. Complete Table 2.1 (if SAP is not available) and/or attach the task SAP for environmental data. Complete Table 2.2 for waste characterization.

SECTION 3.0—APPLICABLE PROTOCOLS, DOCUMENTS, AND WORK INSTRUCTIONS: Identify the applicable protocols and documents (to data quality activities) which will be followed for the data collection activity and document in Table 3.1. Work instructions may be required for task-specific tasks.

When available and appropriate for the sample matrix, SW-846 Methods will be used. When not available, other nationally-recognized methods such as those of ASTM, DOE, and EPA will be used. Analytical methods are listed in Table 2.0 and in analytical SOWs; therefore, an additional listing of analytical methods is not required in Table 3.1.

SECTION 4.0—CALIBRATION PROTOCOLS AND FREQUENCIES: This section addresses documentation of field equipment and field support laboratory equipment which is to be calibrated for the task. Fixed-base laboratory calibration protocols and frequencies are not required to be included in this plan but are covered in the laboratory QA plans and protocols. The SMO oversight/audit has ensured the laboratory has met the requirements of SW-846. Calibration protocols and frequency information may be attached to this QA/DMP.

Identify the field equipment and field support laboratory equipment to be used during the data collection activity and document in Table 4.1 or attach supplemental information concerning equipment calibrations, the protocols, and frequencies.

SECTION 5.0—DATA REVIEW PROCESS: For details on the data review process, refer to PMSA-1001, *Quality Assured Data*, Appendices E, F, G, and H. Complete verification and assessment.

For the purposes of this section, contractual screening, data verification, and data assessment frequencies are identified in Table 5.1, Table 5.2, and Table 5.4, respectively; however, responsible personnel for these tasks must be identified and documented in the appropriate tables. Complete and attach Appendix G, "Data Quality Checks," from PMSA-1001, *Quality Assured Data*, to better define verification and assessment criteria. Complete Table 5.3 to document the validation strategy defined by the task team.

SECTION 6.0—DOCUMENT AND RECORDS CONTROL AND TRANSFER: Identify the documents and records to be controlled during the task, the document or record name and type (i.e., a document such as a QA project plan or a record such as a logbook) and the frequency of transfer of the document or record to the EMEF DMC. Record this information in Table 6.1 for documents and Table 6.2 for records.

SECTION 7.0—QUALITY ASSESSMENT SCHEDULE: Identify and document in Table 7.1 the quality assessments to be performed for the task as requested by the Task Lead or other applicable managers.

DISTRIBUTION LIST: Identify and document the appropriate personnel to receive a copy of the QA/DMP.

REVIEWING, APPROVING, AND ISSUING THE QA/DMP: Upon completion of the above instructions, the QA/DMP should be printed, noticeably stamped "DRAFT," and provided to the appropriate personnel for review. Comments should be received and resolved in a timely manner. The revised QA/DMP should be printed, approved, and provided to the appropriate personnel as defined in the distribution list.

DATE OF ISSUE: **DATE**

DOCUMENT NO., REV. NO.

<u>PROJECT TITLE</u> QUALITY ASSURANCE AND DATA MANAGEMENT PLAN

AUTHOR(S)

Prepared by
Environmental Management and Enrichment Facilities
Kevil, Kentucky 42053
Managed by
BECHTEL JACOBS COMPANY
for the
U. S. DEPARTMENT OF ENERGY
Under Contract No. DE-AC05-98OR22700

$\frac{\textit{PROJECT TITLE}}{\text{QUALITY ASSURANCE AND DATA MANAGEMENT PLAN}}$

APPROVALS

Prepared by:		Da	te:
1	Name Title		-
	1		
Prepared by:		Da	te:
	Name Title		
Annroyed by		Da	te:
Approved by.	Name	Da	
	Title		
Approved by:	*	Da	te:
	Name Title	at .	
Approved by:		Da	te:
	Name Title		
Approved by:		Da	te:
	Name Title		*
Approved by:	A.r.	Da	te:
	Name Title		

CONTENTS

1.0	TASK ORGANIZATION, RESPONSIBILITY, AND TRAINING
2.0	DATA QUALITY OBJECTIVES AND SAMPLE PLANNING
3.0	APPLICABLE PROTOCOLS AND DOCUMENTS
4.0	CALIBRATION PROTOCOLS AND FREQUENCIES
5.0	DATA REVIEW PROCESS
6.0	DOCUMENT AND RECORDS CONTROL AND TRANSFER
7.0	ASSESSMENT SCHEDULE

ATTACHMENTS

- Organizational Chart
 Training Matrix
 DQO Documentation
 Sampling and Analysis Plan
 Figures/Drawings of Area
 Calibration Protocols and Frequencies
 Data Quality Checks Checklist

1.0 TASK ORGANIZATION, RESPONSIBILITY, AND TRAINING

Table 1.1. Task Organization, Responsibility, and Training.

Job Title or Position	Name	Role, Responsibility, and	Training*
		Interface	
DOE Project			
Manager			
Data Clerk			
Data Manager	M&I Data Manager/		
	Subcontractor Personnel		
Network	M&I Network Administrator		
Administrator			
Project			
Manager			
Project			
Engineer		4	
QA Specialist			
Records Clerk			
Records	M&I Records Manager/		
Manager	Subcontractor Personnel		
Sample	M&I Sample Manager/		
Manager	Subcontractor Personnel	*	
Task Lead			
Task Manager			
Field Team	Subcontractor Personnel		
Leader	- I or		
Samplers	Subcontractor Personnel		
Drillers	Subcontractor Personnel		
Other	Subcontractor Personnel		
Other	Subcontractor Personnel		

*The required training (GET, GERT, RAD II, etc.) should be identified for Subcontractor Personnel for this project	ct.
Identify Location of Training Records for Subcontractor Personnel:	

6-56

Α-

2.0 DATA QUALITY OBJECTIVES AND SAMPLE PLANNING

Table 2.1. DQOs and sample planning for environmental data collection.

Sampling Location	Matrix	Sampling Method(s)	Sampling Frequency	Data Type(s) (Screen or Def)	Analyte(s)	Analytical Method	Detection Limit(s)	Holding Time	Container	Preservative
				1	Regular Sample	S		0		
		2								
	140		17							A.A.
						, ,				
					QC Samples					
				ni el i						
				gr e						
							4.00			

4-15

Table 2.2. DQOs and sample planning for waste characterization data collection

Material/	Preliminary	Chanastai					tion data collection	l.	
Volume/ Container	Classification	Characterizat ion Method	Future Disposition	Analyte(s)	Analytical Method	Detection Limit(s)	Holding Time	Container	Preservativ
				Re	gular Sample	es .			
				_					
					2		a .		
,									
				QC	C Samples				

3.0 APPLICABLE DOCUMENTS, PROTOCOLS, AND WORK INSTRUCTIONS

Table 3.1. Applicable documents, protocols, and work instructions.

Protocol Number	Protocol Name	Applicability		
		Yes	No	
	General			
	List appropriate protocols for to be used for chain-of-custodies, logbooks, ensuring quality data, etc.			
	Sampling			
	List appropriate sampling protocols to be used.			
	Data Management			
	List appropriate data management protocols to be used.			
	Data Validation			
	List appropriate data validation protocols to be used.		11.	

4.0 CALIBRATION PROTOCOLS AND FREQUENCIES

Table 4.1. Field equipment and field support laboratory calibration protocols and frequencies.

Fauin mand C C . 1 1	771 1177		Proceeding with	1
Equipment & Serial No.	Field Usage	Calibration Check	Calibration Check	Calibration Check
		Frequency	Material	Protocol
		Field Equipment		
1				
				F
			-	
	Field	Support Laboratory Equi	m	
	1 iciu i	support Laboratory Equip	pment	
		T		
1				
		1		

5.0 DATA REVIEW PROCESS

	Table	5.1. Contractual screen	ing.	
tor re-				
Responsib	le Person:			
Oth	er:			
-1-	8	1.50 D. (C. ()		
	Tal	ole 5.2. Data verification	l	
Responsib	le Person:			
Oth	er:			
a ·				
	Table. 5.3. De	tails for performing data	a validation.	
Frequency	Data Package Type	Analytes & Media	Protocol Used	Completed By
		5		
Responsible Perso	n:			
	Ta	ble 5.4. Data assessment		
Responsib	le Person:			(4)

6.0 DOCUMENT AND RECORDS CONTROL AND TRANSFER

	Table 6.1. Idea	ntification of docume	ents.	
Document Name and Type	Controlled Document (Yes* or No)	Storage Location	Frequency of Transfer	Comments
			*	
		·		

^{*} If a document is identified as a "controlled document", then a distribution list must be created, maintained, and updated, as needed. The access control method for the "controlled document" must be defined and implemented.

Table 6.2. Identification of records.						
Record Name and Type	Quality Record (Yes or No)	Storage Location	Frequency of Transfer	Comments		
a .						

7.0 ASSESSMENT SCHEDULE

Audit/Surveillance/ Self Assessment No.	Subject/Topic	Date	Completed By
Sen Assessment No.			
	(SF 1)		
			×

DISTRIBUTION

(List appropriate names and associated organization, if needed, for distribution of document.)

APPENDIX B

DATA DICTIONARY AND FORMATS FOR PADUCAH OREIS TRANSMITTALS

TRANSMITTAL FORMAT

Transmittal format for all data transmittals will be in exported database format (.dbf) and as a Microsoft Access table (version 97 or more recent). The file will be added to the password-protected external server under the base directory \home\oreis\data\ in a zipped file named according to the structure outlined below that corresponds to Table 1 in addition to other applicable transmittals.

KPDES Permit DOE Outfalls, Toxicity Monitoring, Bioaccumulation Study, Fish Community ...\data\permit\KPDES\KPDESTYYYY-MM

where T corresponds

corresponds to the sample type (i.e., R=regular permitted sampling, T=toxicity sampling, B=bioaccumulation sampling, F=fish community sampling)

YYYY corresponds to the calendar year, and

MM corresponds to the month

C-746-K Surface Water, C-746-K Groundwater

...\data\permit\C746K\KMYYYY-SA

where M corresponds to the media (i.e., S=Surface water, G=Groundwater)

YYYY corresponds to the calendar year, and

SA corresponds to the 1st or 2nd half of the year

C-746-S&T Surface Water, C-746-S&T Groundwater, C-746-S&T Leachate

...\data\permit\C746S&T\S_TMYYYY-QQ

where M corresponds to the media (i.e., S=Surface water, G=Groundwater, L=Leachate)

YYYY corresponds to the calendar year, and

QQ corresponds to the quarter

C-746-U Surface Water, C-746-U Groundwater, C-746-U Leachate

...\data\permit\C746U\UMYYYY-QQ

where M corresponds to the media (i.e., S=Surface water, G=Groundwater, L=Leachate)

YYYY corresponds to the calendar year, and

QQ corresponds to the quarter

C-404 Groundwater, C-404 Leachate

...\data\permit\C404\404MYYYY-SA

where M corresponds to the media (i.e., S=Surface water, G=Groundwater, L=Leachate)

YYYY corresponds to the calendar year, and

SA corresponds to the 1st or 2nd half of the year

Environmental Monitoring Surface Water Sampling

...\data\envmon\SW-YYYY

where YYYY corresponds to the calendar year

Environmental Monitoring Sediment Sampling

...\data\envmon\SD-YYYY

where YYYY corresponds to the calendar year

Environmental Monitoring Deer Sampling

...\data\envmon\D-YYYY

where YYYY corresponds to the calendar year

Environmental Monitoring Plume Groundwater Sampling

...\data\envmon\Pl-GW\PlGWYYYY-QQ

where YYYY corresponds to the calendar year, and OO corresponds to the quarter

Environmental Monitoring Residential Groundwater Sampling

...\data\envmon\Res-GW\ResGWYYYY-SA

where YYYY corresponds to the calendar year, and

SA corresponds to the 1st or 2nd half of the year

Environmental Monitoring Surveillance Groundwater Sampling

...\data\envmon\Sur-GW\SurGWYYYY-SA

where YYYY corresponds to the calendar year, and

SA corresponds to the 1st or 2nd half of the year

S&M/O&M Northwest Plume Operations Sampling

...\data\sm_om\NWYYYY-QQ

where YYYY corresponds to the calendar year, and

QQ corresponds to the quarter

S&M/O&M Northeast Plume Operations Sampling

...\data\sm om\NEYYYY-QQ

where YYYY corresponds to the calendar year, and

QQ corresponds to the quarter

DOE Remedial Action Investigations

...\data\ra\PROJCODE

where PROJCODE corresponds to the PROJ_CODE in Paducah OREIS (e.g., ERI-WAG6, ERI98-698W22, etc.)

Special Requests

...\data\requests\YYYYMMDD-A

where YYYY corresponds to the calendar year,

MM corresponds to the month,

DD corresponds to the day of the request, and

A corresponds to the sequential number for the request.

Lithology

...\data\lith\PROJCODE

where PROJCODE corresponds to the PROJ_CODE in Paducah OREIS from which the lithology description was collected (e.g., ERI-WAG6, ERI-WAG 27, LASAGNA, etc.)

GIS Themes/Coverages

...\data\gis\

Each file will be named to appropriately describe the theme/coverage. Updates to themes/coverages will be named identical to the previous version with a revision number immediately following (e.g., roads, roads1, roads2,etc).

GIS Themes/coverages will be in a format compatible to be viewed in ArcView 2.0 or higher (i.e.,

ArcInfo Coverages, AutoCAD drawings, etc.)

DATA DICTIONARY INFORMATION

CODE

The CODE table contains the codes used in Paducah OREIS tables and their descriptions.

CODE

Code referenced in other Paducah OREIS tables.

CODE DESCRIPTION CODE TYPE

Description of the coded value. This is the 'decoded' value.

Column name for the codes and descriptions. This value identifies the type

of coded value.

PROJECT FLD SMP MEAS

The export of PROJECT FLD SMP MEAS table contains the measurement data taken in the field, which is associated with specific SAMPLEs collected during a STATION_EVENT. Examples are flow rate, depth, and temperature. Only those field measurements directly associated with a SAMPLE will be stored in the FLD_SMP_MEAS table. Field measurement data collected, not directly associated with a SAMPLE (e.g., water level suites) will also be in this format.

PROJ_CODE

Acronym assigned by the project (e.g., "ERI-WAG6" for the WAG 6

STA NAME

Environmental Restoration Field Investigation). Unique station name assigned by the individual projects (e.g., 400-212

or MW156).

PROJ SAMPLE ID SAMPLE_COMMENTS

Unique sample identifier assigned by the project.

Comments about the sample.

SMP_STRT_LEVEL

For a measurement taken over a range of elevations or depths, the upper

vertical distance in feet of the measurement from ground surface.

SMP_END LEVEL

For a measurement taken over a range of elevations or depths, the lower vertical distance in feet of the measurement from ground surface.

MED TYPE

Coded value that represents the part of the environment from which a sample is collected, or on which a field measurement or observation is made. See CODE table where CODE_TYPE = MED_TYPE for a list of

valid values and their descriptions.

SMP TYPE

Coded value that represents the type of sample collected. See CODE table where CODE_TYPE = SMP_TYPE for a list of valid values and

their descriptions.

D_COLLECTED CHEMICAL NAME

Date sample was collected.

Description of the chemical or measurement parameter. For CAS numbers, this is the preferred name defined by the Common Lab

Practices Committee.

CAS_NUM

Chemical Abstract Services number with dashes, blank if no CAS

number is available.

LAB_CODE

Coded value assigned by the project that represents the analytical laboratory that performed the analysis of the sample. See the CODE table where CODE_TYPE = LAB_CODE for a list of valid values and

their descriptions.

RESULTS

Measurement for a given parameter.

RSLT_PREFIX_QUALIFIER

A qualifier indicating whether the result is below, within, or above

range limits. See CODE table where CODE_TYPE =

RSLT_PREFIX_QUALIFIER for a list of valid values and their

descriptions.

Coded value that documents any conditions associated with the results RSLTQUAL

of the analysis. See CODE table where CODE_TYPE = RSLTQUAL

for a list of valid values and their descriptions.

Coded value that represents the units of measure used to report the UNITS

parameter value. See CODE table where CODE_TYPE = UNITS for a

list of valid values and their descriptions.

For Paducah OREIS, this field designates electronic verification NON_COMPLI_CODE

qualifiers assigned during the Data Assessment process according to

PMSA-1001. See CODE table where CODE_TYPE =

NON_COMPLI_CODE for a list of valid values and their descriptions. A null field may indicate no criteria were established or may indicate verification was clear. Non-standard criteria are established on a

project-by-project basis.

Coded value that represents the outcome of the data validation process. VALIDATION

See CODE table where CODE_TYPE = VALIDATION for a list of

valid values and their descriptions.

Coded value describing assessment qualifiers added to data as a result of ASSESSMENT

PMSA-1001. Applies only to data generated after effective date of procedure. See CODE table where CODE_TYPE = ASSESSMENT for

a list of valid values and their descriptions. Comments about the measurement.

FLD COMMENTS ANA METHOD

Method number used to identify a standard analysis method.

Coded value of the chemical group to which the analyte belongs. See ANA TYPE

CODE table where CODE_TYPE = ANA_TYPE for a list of valid

values and descriptions.

PROJECT LAB MEAS

The export of PROJECT LAB MEAS table contains the measurement data analyzed by an analytical laboratory, which is associated with specific SAMPLEs collected during a STATION_EVENT.

PROJ CODE

Acronym assigned by the project (e.g., "ERI-WAG6A" for the WAG 6

Environmental Restoration Field Investigation).

STA_NAME

Unique station name assigned by the individual projects (e.g., 400-212

or MW156).

PROJ SAMPLE ID SAMPLE COMMENTS Unique sample identifier assigned by the project.

Comments about the sample.

SMP STRT_LEVEL

For a measurement taken over a range of elevations or depths, the upper vertical distance in feet of the measurement from ground surface.

SMP END_LEVEL

For a measurement taken over a range of elevations or depths, the lower vertical distance in feet of the measurement from ground surface.

MED TYPE

Coded value that represents the part of the environment from which a sample is collected, or on which a field measurement or observation is made. See CODE table where CODE_TYPE = MED_TYPE for a list of

valid values and their descriptions.

SMP TYPE

Coded value that represents the type of sample collected. See CODE table where CODE TYPE = SMP_TYPE for a list of valid values and

their descriptions.

D COLLECTED

Date sample was collected.

CHEMICAL_NAME

Description of the chemical or measurement parameter. For CAS numbers, this is the preferred name defined by the Common Lab

Practices Committee.

CAS_NUM

Chemical Abstract Services number with dashes, blank if no CAS

number is available.

LAB CODE

Coded value assigned by the project that represents the analytical laboratory that performed the analysis of the sample. See the CODE table where CODE_TYPE = LAB_CODE for a list of valid values and their descriptions.

RESULTS

RSLT_PREFIX_QUALIFIER

Measurement for a given parameter.

A qualifier indicating whether the result is below, within, or above

range limits. See CODE table where CODE_TYPE =

RSLT_PREFIX_QUALIFIER for a list of valid values and their

descriptions.

RSLTQUAL

Coded value that documents any conditions associated with the results of the analysis. See CODE table where $CODE_TYPE = RSLTQUAL$

for a list of valid values and their descriptions.

UNITS

Coded value that represents the units of measure used to report the parameter value. See CODE table where CODE_TYPE = UNITS for a

list of valid values and their descriptions.

RAD ERR

The counting error for a specific radionuclide expressed as 2 standard

deviations.

NON_COMPLI_CODE

For Paducah OREIS, this field designates electronic verification qualifiers assigned during the Data Assessment process according to

PMSA-1001. See CODE table where CODE_TYPE =

NON_COMPLI_CODE for a list of valid values and their descriptions. A null field may indicate no criteria were established or may indicate verification was clear. Non-standard criteria are established on a

project-by-project basis.

VALIDATION

Coded value that represents the outcome of the data validation process.

See the CODE table where CODE_TYPE = VALIDATION for a list

valid values and their descriptions.

ASSESSMENT

Coded value describing assessment qualifiers added to data as a result of PMSA-1001. Applies only to data generated after effective date of procedure. See CODE table where CODE_TYPE = ASSESSMENT for

a list of valid values and their descriptions.

LAB_COMMENTS ANA_METHOD

Comments about the individual sample.

ANA TYPE

Method number used to identify a standard analysis method.

Coded value of the chemical group to which the analyte belongs. See CODE table where CODE_TYPE = ANA_TYPE for a list of valid

values and descriptions.

STATION-LOCATION

The export of STATION-LOCATION table contains the data about sampling points associated with one or more projects. Each point has a distinct station name/station type within a project. Locational information contains coordinate and other information describing a point on the ground. Most location are points described by x,y coordinates, but a location could be a line or a polygon where measuring events occur. In those cases, a single point, such as the estimated center point, is used.

STA_NAME STA_TYPE Unique station name assigned by the individual projects (e.g., GW101). Coded value that represents the type of station (e.g., seep, spring, well). See CODE table where CODE_TYPE = STA_TYPE for a list of valid

values and their descriptions. Comments about the station.

STATION_COMMENTS

STA_DESC GRND_ELV Description of the specific sampling or measuring location.

Elevation of ground surface (for groundwater, soil, or sediment sampling) at a sampling or measuring location in feet above mean sea

level (msl).

ADMIN EAST

X-value of the distance in feet of a sampling or measuring location from the reference location based on the administrative coordinate grid

system.

ADMIN_NORTH

Y-value of the distance in feet of a sampling or measuring location from the reference location based on the administrative coordinate grid

system.

SWMU

LOCATION COMMENTS

DATUM

Acronym for Solid Waste Management Unit, if applicable.

Comments about the location.

Coded value that represents the method by which reference points were established (e.g., NAD27, NAD83). Datum should be associated with the state plane coordinate system. It is not valid for administrative grid. See CODE table where CODE_TYPE = DATUM for a list of valid

values and their descriptions.

SPLANE EAST

X-value of the distance in meters of a sampling or measuring location from the reference location based on the state plane coordinate grid

system.

SPLANE NORTH

Y-value of the distance in meters of a sampling or measuring location from the reference location based on the state plane coordinate grid

system.

LOC_ERROR LOC METHOD

Station location error in feet.

Coded value that represents the method used for locating the station. See CODE table where CODE TYPE = LOC METHOD for a list of

valid values and their descriptions.

LITHOLOGY

The LITHOLOGY export provides a description of a material (e.g., sand, gravel) encountered underground at a given location at a specific interval within a well, borehole, etc. and the discrete fixed top and bottom points of the interval where the sample was taken.

CONSTR_DEPTH_VAL

The total measurement from the ground surface of a hole downward to the bottom of the screening material in a well, expressed in feet. HOLE DIAM

Diameter in inches of the well. If more than one diameter is available, this column will contain the smallest diameter and the others will be listed in the COMMENTS column.

LOG_FLAG

A flag which indicates that reference source information (e.g., geophysical logs) exists.

LOG_TYPE

Coded value that represents a specific geophysical log. An example would be CL for Caliper Log, GRL for Gamma Ray Log. A name or abbreviation representing a type of LOG used in geologic work (e.g., driller, caliper, gamma). See CODE table where CODE TYPE = LOG_TYPE for a list of valid values and their descriptions.

TOT_DRILLED_DEPTH

The total measurement from the ground surface to the bottom of a newly-constructed well after any plug back material has been added, expressed in feet.

INT_BOT_DEPTH_VAL

The distance in feet, from the ground surface to the bottom of a monitored interval.

INT_TOP_DEPTH_VAL

The distance in feet, from the ground surface to the top of a monitored interval.

MONIT_INT_NAME

The name (or number) assigned to a given monitored interval at a given location

MONIT_ZONE_CODE

Coded value that represents the generic interval of a saturated zone that a hole monitors. A monitored interval can cut across multiple zones. See CODE table where CODE_TYPE = MONIT_ZONE_CODE for a list of valid values and their descriptions.

INT_MATL_CODE

Coded value that represents a specific characteristic or set of characteristics of the solid content found at a specific location. See CODE table where CODE_TYPE = INT_MAT_TYPE for a list of valid values and their descriptions.

STRAT_SEQ

Number assigned by the site geologist to each distinct lithologic layer at

VISUAL DESC

Textual and mineralogical description of the material comprising the layer to augment or qualify the lithtype code (e.g., grain sizes, color, secondary characteristics).

DISTRIBUTION

Bechtel Jacobs Company LLC

R. Barber

J. R. Blewett

B. A. Bowers

T. L. Brindley

R. D. Brooksbank

J. E. Buckmaster

D. L. Chumbler

R. D. Ferguson

R. L. Foster

J. G. Garner

L. K. Garner

P. A. Gourieux

D. R. Guminski

A. L. Harrington

D. A. Hill

C. S. Jones

R. J. Keeling

D. M. Massey

J. C. Massey

A. S. Masvidal

G. R. Miller

J. W. Morgan

L. D. Payne

R. E. Scott M. H. Shanks

J. W. Thiesing

R. R. Veazey

D. Whitaker-Sheppard

J. L. White

J. G. Williamson

Information Resource Center-OR

PGDP EMEF DMC - RC (2)

Department of Energy

D. M. Carden, ORO

N. L. Carnes, ORO

D. W. Dollins, PAD

G. S. Hartman, ORO

J. C. Hodges, PAD (3)

K. Kates, ORO

M. E. Redfield, PAD

R. C. Sleeman, ORO

D. B. Williams, HQ

Environmental Protection Agency

C. R. Froede, Jr. (3)

Jacobs Engineering Group

B. E. Phillips (2)

Kentucky Department of Fish and Wildlife

W. L. Davis

Lockheed Martin Energy Research

C. T. Rightmire

Natural Resources Trustees

J. A. Barber

A. H. Loudermilk

A. B. Perkins

A. Robison

Site-Specific Advisory Board

M. Donham

V. W. Jones

SSAB Office File

State of Kentucky

R. H. Daniell

S. Hampson

T. Mullins

T. M. Taylor (3)

J. A. Volpe

Systematic Management Systems

W. F. Redfield

Tennessee Valley Authority

T. Whitaker

USEC

T. M. Taimi

U.S. Geological Survey

T. Mesko

West Kentucky Wildlife Management Area

W. D. Hendrick

to the transfer of the second

and 10 mg m

enga 17 o 16 og seguri skyt.

emografia to the second of the second

e ma at un care e perte les cuert

to the second

· 在 在

Manager (1997)

GAS LIMBER IN CREEN MORE CREEN B. Williams CID

of the money of the